

June 28, 2019
File No. 262018.063

Ms. Corina Forson
Chief Hazards Geologist
State of Washington
Department of Natural Resources
Washington Geological Survey
111 Washington Street SE
Olympia, Washington 98504

Mr. Scott Black
Program Development Manager
State of Washington
Office of Superintendent of Public Instruction
600 Washington Street
Olympia, Washington 98504

Subject: Department of Natural Resources Washington Geological Survey,
School Seismic Safety Assessment Project, Contract No. AE 410 -
Seismic Evaluation for **Port Angeles School District**

Dear Ms. Forson and Mr. Black:

Reid Middleton and our consultant team, under the direction of The Department of Natural Resources (DNR) Washington Geological Survey (WGS) School Seismic Safety Project, have conducted seismic evaluations of 222 school buildings and 5 fire stations throughout Washington State. This letter is transmitting the results of these seismic assessments for each school district that graciously participated in this statewide study. We understand that you will be forwarding this letter and the accompanying seismic screening reports to each school district for their reference and use.

Many disparate studies on improving the seismic safety of our public school buildings have been performed over the last several decades. Experts in building safety, geologic hazards, emergency management, education, and even the news media have been asserting for decades that seismic risks in older public school buildings represent a risk to our communities. The time to act is now, before we have a damaging earthquake and/or tsunami that could be catastrophic. This statewide school seismic safety assessment project provides a unique opportunity to draw attention to the need for statewide seismic safety policies and funding on behalf of all school districts that will help enable school districts to increase the seismic safety of their older buildings to make them safer for students, teachers, staff, parents, and the community.

It is not the intent of this study to create an unfunded mandate for school districts to seismically upgrade their schools without associated funding or statewide seismic safety policy support. The overall goal of this study was to screen and evaluate the current levels of seismic vulnerabilities of a statewide selection of our older public school buildings and to use the data

EVERETT
728 134th Street SW
Suite 200
Everett, WA 98204
425 741-3800

www.reidmiddleton.com

and information to help quantify funding and policy needs to improve the seismic safety of our public schools. In this process, we are using the information to inform not only the Governor and the Legislature of the policy and funding needs for seismically safe schools but also the school districts that participated in the study.

School Buildings Evaluated in the Port Angeles School District

We appreciate Port Angeles School District's participation and invaluable assistance in this statewide project. The following school district building was included as part of this study:

1. Roosevelt Elementary School, Main Building

The seismic screening of this building was performed using the American Society of Civil Engineers' Standard 41-17, *Seismic Evaluation and Retrofit of Existing Buildings* (ASCE 41-17), national standard Tier 1 structural and nonstructural seismic screening checklists specific to each building's structure type.

The WGS also conducted seismic site class assessments to measure the shear wave velocity and determine the soil site class at each campus. Site class is an approximation of how much soils at a site will amplify earthquake-induced ground motions and is a critical parameter used in seismic design. Reid Middleton subsequently used this information in their seismic screening analyses.

The following table is a list of available seismic assessment information used in our study:

School Building	Year Constructed	FEMA Building Classification	Structural Drawings Available for Review
Roosevelt Elementary School, Main Building	1978	Wood Frame	Yes

Detailed descriptions of the seismic screening evaluations of this building can be found in the individual building reports and the ASCE 41-17 Tier 1 screening checklist documents enclosed with this letter. This information will also be available for download on the WGS website: <https://www.dnr.wa.gov/programs-and-services/geology/geologic-hazards/earthquakes-and-faults/school-seismic-safety>.

These Tier 1 seismic screening checklists are often the first step employed by structural engineers when trying to determine the seismic vulnerabilities of existing buildings and to begin a process of mitigating these seismic vulnerabilities. School district facilities management personnel and their design consultants should be able to take advantage of this information to help inform and address seismic risks in existing or future renovation, repair, or modernization projects.

It is important to note that information used for these school seismic screenings was limited to available construction drawings and limited site observations by our team of licensed structural engineers to observe the general conditions and configuration of each building being seismically screened. In many cases, construction drawings were not available for review as noted in the table above. Due to the limited scope of the study, our team of engineers were not able to perform more-detailed investigations above ceilings, behind wall finishes, in confined spaces, or in other areas obstructed from view. Where building component seismic adequacy was unknown due to lack of available information, the unknown conditions were indicated as such on the ASCE 41-17 Tier 1 checklists. Additional field investigations are recommended for the “unknown” seismic evaluation checklist items if more-definitive determinations of seismic safety compliance and further development of seismic mitigation strategies are desired.

Nonstructural Seismic Screening

The enclosed ASCE 41-17 Tier 1 Nonstructural Seismic Screening checklists can provide immediate guidance on seismic deficiencies in nonstructural elements. Mitigating the risk of earthquake impacts from these nonstructural elements should be addressed as soon as practical by school districts. Some nonstructural elements may be easily mitigated by installing seismic bracing of tall cabinets, moving heavy contents to the bottom of shelving, and adding seismic strapping or bracing to water tanks and overhead elements (light fixtures, mechanical units, piping, fire protection systems, etc.).

It is often most economical to mitigate nonstructural seismic hazards when the building is already undergoing mechanical, electrical, plumbing, or architectural upgrades or modernizations. Enclosed with these nonstructural seismic screening checklists are excerpts from the Federal Emergency Management Agency (FEMA) publication E-74 entitled, *Reducing the Risks of Nonstructural Earthquake Damage* (FEMA E-74). We have included these FEMA publication excerpts to help illustrate typical seismic mitigation measures that can potentially be implemented by district facilities and maintenance personnel.

Structural Seismic Screening

The enclosed ASCE 41-17 Tier 1 Structural Seismic Screening checklists have evaluation statements that are reviewed for specific building elements and systems to determine if these items are seismically compliant, noncompliant, not applicable, or unknown. These evaluation statements provide guidance on which structural systems and elements have identified seismic deficiencies and should be investigated further. Further seismic evaluations beyond these seismic screening checklists typically consist of more-detailed seismic structural analyses to better define the seismic vulnerabilities and risks. This information is then used to determine cost-effective ways to seismically improve these buildings with stand-alone seismic upgrade projects or incrementally as part of other ongoing building maintenance, repair, or modernization projects. Consequently, implementing seismic structural mitigation strategies typically requires that they be developed as a part of longer-term capital improvements and modernization programs developed by the school district and their design consultants.

Next Steps

Due to the screening nature of the ASCE 41-17 Tier 1 procedures, an in-depth seismic evaluation and analysis of these buildings may be needed before detailed seismic upgrades or improvements, conceptual designs, and probable construction cost estimates are developed.

If you have any questions or comments regarding the engineering reports or would like to discuss this further, please contact us.

Sincerely,



David B. Swanson, P.E., S.E.
Principal, LEED AP, F.SEI



Limitations

The professional services described in this document were performed based on available information and limited visual observation of the structures. No other warranty is made as to the professional advice included in this document. This document has been prepared for the exclusive use of the Department of Natural Resources, the Office of the Superintendent of Public Instruction, and this school district and is not intended for use by other parties, as it may not contain sufficient information for other parties' purposes or their uses.

1. Port Angeles, Roosevelt Elementary School, Main Building

1.1 Building Description

Building Name:	Main Building
Facility Name:	Roosevelt Elementary School
District Name:	Port Angeles
ICOS Latitude:	48.103
ICOS Longitude:	-123.39
ICOS	
County/District ID:	5121
ICOS Building ID:	14120
ASCE 41 Bldg Type:	W2
Enrollment:	502
Gross Sq. Ft. :	23,785
Year Built:	1978
Number of Stories:	1
S _{XS} BSE-2E:	1.118
S _{X1} BSE-2E:	0.614
ASCE 41 Level of Seismicity:	High
Site Class:	C
V _{S30} (m/s):	431
Liquefaction	
Potential:	very low
Tsunami Risk:	Extremely Low
Structural Drawings Available:	Yes
Evaluating Firm:	Reid Middleton, Inc.



Roosevelt Elementary School is a one-story, 23,800 square foot school building that was originally constructed in 1978. The building has brick cladding at most exterior locations. A central courtyard, surrounded by windows, occurs between the building's main corridors. Originally constructed as a middle school, the loading dock and shop spaces at the North end of the school have been converted to classrooms. Framing consists primarily of engineered wood joists and glulam beams at the roof, with a plywood diaphragm. Walls consist of brick-clad CMU at the two ends of the building and brick-clad wood framing in the middle (classroom and office) areas. A newer gym addition occurs at the southwestern corner of the building, constructed of tilt-up concrete walls and a steel joist and metal deck roof.

1.1.1 Building Use

The building serves as an elementary school with approximately 500 students. A small playground occurs at the northeastern corner, with larger playfields located South of the building. The building was originally constructed as a middle school and has large flexible shop spaces at the North end which have been converted to classrooms.

1.1.2 Structural System

Table 1.1-1. Structural System Description of Roosevelt Elementary School

Structural System	Description
Structural Roof	The roof throughout the main school building consists of engineered wood trusses (TJ) varying from 24-inches to 38-inches in depth. These are supported by glulam beams at the interior and bearing walls and glulam beam headers at the perimeter. 58 1/2-inch deep glulam beams and 13 1/2-inch glulam joists are used at the main gym. A 3/4-inch plywood diaphragm is provided throughout. The roof at the gym addition consists of custom steel trusses with metal deck.
Structural Floor(s)	The floor consists of a 4-inch concrete slab-on-grade with welded-wire reinforcing. At the choir room, three large steps are provided to make a recessed area.
Foundations	The foundation consists of continuous concrete footings at the wood and masonry bearing walls and at the tilt-up concrete panels at the gym addition. Concrete pad footings are provided at steel column locations.
Gravity System	Gravity system supporting the roof consists of CMU bearing walls and steel posts through much of the original school building. Wood wall framing is used at much of the northwestern face and the office area. Tilt-up concrete bearing walls are used at the Gym Addition
Lateral System	The lateral system consists of the roof diaphragms supported by wood and CMU shear walls at the original building and tilt-up concrete panels at the Gym Addition. Brick walls are cladding only, supported by wood or CMU shear walls along the perimeter.

1.1.3 Structural System Visual Condition

Table 1.1-2. Structural System Condition Description of Roosevelt Elementary School

Structural System	Description
Structural Roof	No visible deterioration or damage was observed.
Structural Floor(s)	No visible deterioration or damage was observed.
Foundations	No visible deterioration or damage was observed.
Gravity System	No visible deterioration or damage was observed.
Lateral System	No visible deterioration or damage was observed.

1.2 Seismic Evaluation Findings

1.2.1 Structural Seismic Deficiencies

The structural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation.

Table 1-3. Identified Structural Seismic Deficiencies for Port Angeles Roosevelt Elementary School Main Building

Deficiency	Description
Shear Stress Check	The central portion of the building is large, but relies primarily on perimeter shear walls. Intermediate walls or frames may be needed at the building interior. Further investigation should be performed. Lateral system strengthening or addition of new shear walls may be appropriate to mitigate seismic risk.
Diagonally Sheathed and Unblocked Diaphragms	The center of the building appears to be unsupported, requiring the diaphragm to span most of the building's width. Additional interior shear walls may be required. Further investigation should be performed. Diaphragm reinforcement may be appropriate to mitigate seismic risk.

1.2.2 Structural Checklist Items Marked as 'Unknown'

Where building structural component seismic adequacy was unknown due to lack of available information or limited observation, the structural checklist items were marked as “unknown”. These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown structural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Table 1-4. Identified Structural Checklist Items Marked as Unknown for Port Angeles Roosevelt Elementary School Main Building

Unknown Item	Description
Liquefaction	The liquefaction potential of site soils is unknown at this time given available information. Very low liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	A gully with reported slope stability issues exists behind the school, close to the gym addition and a portable. The main building is roughly 75 feet or more away. Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault Rupture	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected surface fault ruptures.

1.3.1 Nonstructural Seismic Deficiencies

The nonstructural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation. Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-5. Identified Nonstructural Seismic Deficiencies for Port Angeles Roosevelt Elementary School Main Building

Deficiency	Description
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	No available record drawing information on fire suppression piping and unable to verify during site investigation. Based on age of the building, it is assumed that seismic bracing for fire suppression piping do not comply with NFPA 13. Bracing for fire suppression piping may be appropriate to mitigate seismic risk.
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR-LMH.	No available record drawing information on fire suppression piping and unable to verify during site investigation. Based on age of the building, it is assumed the flexible couplings on the fire suppression piping do not comply with NFPA 13. Flexible coupling for fire suppression piping may be appropriate to mitigate seismic risk.
HM-2 Hazardous Material Storage. HR-LMH; LS-LMH; PR-LMH.	Equipment room bottles stored on shelf with no restraint. Restraining breakable containers that hold hazardous material by latched doors, shelf lips, wires, or other methods may be appropriate to mitigate seismic risk.
HM-3 Hazardous Material Distribution. HR-MH; LS-MH; PR-MH.	No bracing on gas piping notes. Bracing and anchoring of gas piping may be appropriate to mitigate seismic risk.
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Only hard couplings noted. Flexible couplings may be appropriate to mitigate seismic risk.
CF-1 Industrial Storage Racks. HR-LMH; LS-MH; PR-MH.	Tall racks adjacent to the locker rooms did not appear to be anchored.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Items on high shelving in mechanical room, classroom in former shop areas, janitors' closet, and in storage room near lockers.
ME-1 Fall-Prone Equipment. HR-not required; LS-H; PR-H.	Mechanical room equipment generally not braced. Bracing or anchoring of equipment may be appropriate to mitigate seismic risk.
ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Isolated non-braced ceiling hung equipment at mechanical room. Bracing or anchoring of equipment may be appropriate to mitigate seismic risk.

1.3.2 Nonstructural Checklist Items Marked as 'U'known

Where building nonstructural component seismic adequacy was unknown due to lack of available information or limited observation, the nonstructural checklist items were marked as “unknown”. These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown nonstructural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-6. Identified Nonstructural Checklist Items Marked as Unknown for Port Angeles Roosevelt Elementary School Main Building

Unknown Item	Description
LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR-MH.	No available record drawing information on sprinkle head clearance and unable to verify during site investigation. Evaluation of penetrations may be appropriate to mitigate seismic risk.
HM-4 Shutoff Valves. HR-MH; LS-MH; PR-MH.	No shut-off was observed. Further investigation of mechanical piping should be performed. Providing shutoff valves may be appropriate to mitigate seismic risk.
LF-1 Independent Support. HR-not required; LS-MH; PR-MH.	It is unknown how much the light fixtures weigh. Based on the age of the building, it is unlikely that they are independently supported by the structure. Further investigation should be completed. Adding wires for suspending the light fixtures may be appropriate to mitigate seismic risk.
CG-8 Overhead Glazing. HR-not required; LS-MH; PR-MH.	Glazing type not known.
M-1 Ties. HR-not required; LS-LMH; PR-LMH.	No ties are indicated in the drawings, and this cannot be observed. Further investigation should be completed. Adding connections for the veneer may be appropriate to mitigate seismic risk.
M-3 Weakened Planes. HR-not required; LS-LMH; PR-LMH.	No ties are indicated in the drawings, and this cannot be observed. Further investigation should be completed. Adding connections for the veneer may be appropriate to mitigate seismic risk.
M-6 Anchorage. HR-not required; LS-MH; PR-MH.	No ties are indicated in the drawings, and this cannot be observed. Further investigation should be completed. Adding connections for the veneer may be appropriate to mitigate seismic risk.
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Not able to verify during site investigation. Further investigation should be performed. Brace tops of equipment taller than 6 feet to nearest backing wall or provide overturning base restraint.

Photos:



Figure 1-1. Elementary School, Northeast Side with Main Entry



Figure 1-2. Elementary School, North Corner Play Area and Small Retaining Wall



Figure 1-3. Elementary School, North End with Original Shop Area



Figure 1-4. Elementary School, West Face (Gym Addition Beyond, Slope to Northeast)



Figure 1-5. Elementary School, Southeast Face with Maintenance Areas



Figure 1-6. Elementary School, Main Entry Corridor and Courtyard



Figure 1-7. Elementary School, Large Gym



Figure 1-8. Elementary School, Typical Classroom



Figure 1-9. Elementary School, Classroom in Former Shop Area

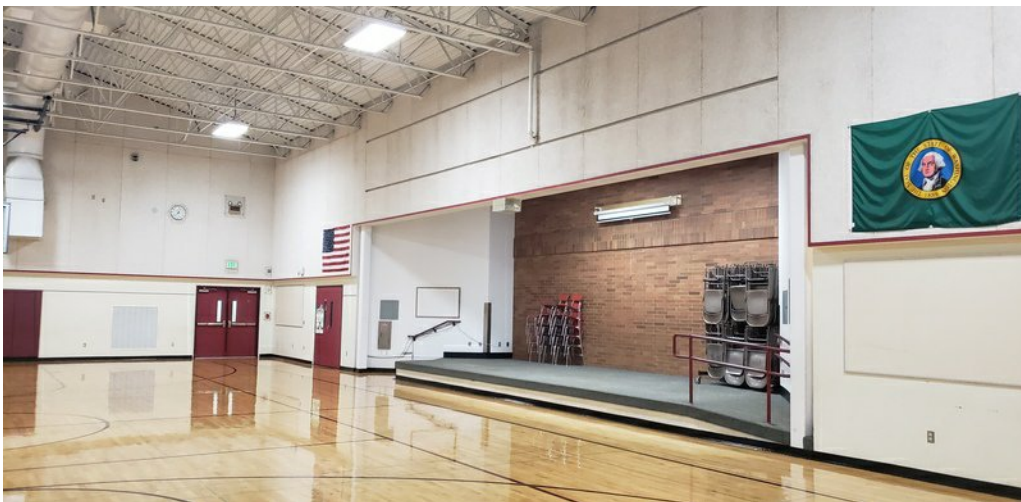


Figure 1-10. Elementary School, Gym Addition with Stage

Port Angeles, Roosevelt Elementary School, Main Building

17-2 Collapse Prevention Basic Configuration Checklist

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Building System - General

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Load Path	The structure contains a complete, well-defined load path, including structural elements and connections, that serves to transfer the inertial forces associated with the mass of all elements of the building to the foundation. (Tier 2: Sec. 5.4.1.1; Commentary: Sec. A.2.1.10)	X				Walls occur around the major spaces.
Adjacent Buildings	The clear distance between the building being evaluated and any adjacent building is greater than 0.25% of the height of the shorter building in low seismicity, 0.5% in moderate seismicity, and 1.5% in high seismicity. (Tier 2: Sec. 5.4.1.2; Commentary: Sec. A.2.1.2)	X				No other building on-site.
Mezzanines	Interior mezzanine levels are braced independently from the main structure or are anchored to the seismic-force-resisting elements of the main structure. (Tier 2: Sec. 5.4.1.3; Commentary: Sec. A.2.1.3)	X				Isolated mezzanine areas are wall-supported.

Building System - Building Configuration

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Weak Story	The sum of the shear strengths of the seismic-force-resisting system in any story in each direction is not less than 80% of the strength in the adjacent story above. (Tier 2: Sec. 5.4.2.1; Commentary: Sec. A.2.2.2)			X		Single story building.
Soft Story	The stiffness of the seismic-force-resisting system in any story is not less than 70% of the seismic-force-resisting system stiffness in an adjacent story above or less than 80% of the average seismic-force-resisting system stiffness of the three stories above. (Tier 2: Sec. 5.4.2.2; Commentary: Sec. A.2.2.3)			X		Single story building.
Vertical Irregularities	All vertical elements in the seismic-force-resisting system are continuous to the foundation. (Tier 2: Sec. 5.4.2.3; Commentary: Sec. A.2.2.4)	X				Walls are continuous.

Geometry	There are no changes in the net horizontal dimension of the seismic-force-resisting system of more than 30% in a story relative to adjacent stories, excluding one-story penthouses and mezzanines. (Tier 2: Sec. 5.4.2.4; Commentary: Sec. A.2.2.5)			X		Single story building.
Mass	There is no change in effective mass of more than 50% from one story to the next. Light roofs, penthouses, and mezzanines need not be considered. (Tier 2: Sec. 5.4.2.5; Commentary: Sec. A.2.2.6)			X		Single story building.
Torsion	The estimated distance between the story center of mass and the story center of rigidity is less than 20% of the building width in either plan dimension. (Tier 2: Sec. 5.4.2.6; Commentary: Sec. A.2.2.7)	X				Walls are well-distributed around the perimeter.

Moderate Seismicity (Complete the Following Items in Addition to the Items for Low Seismicity)

Geologic Site Hazards

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Liquefaction	Liquefaction-susceptible, saturated, loose granular soils that could jeopardize the building's seismic performance do not exist in the foundation soils at depths within 50 ft (15.2 m) under the building. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.1)				X	The liquefaction potential of site soils is unknown at this time given available information. Very low liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	The building site is located away from potential earthquake-induced slope failures or rockfalls so that it is unaffected by such failures or is capable of accommodating any predicted movements without failure. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.2)				X	A gully with reported slope stability issues exists behind the school, close to the gym addition and a portable. The main building is roughly 75 feet or more away. Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault Rupture	Surface fault rupture and surface displacement at the building site are not anticipated. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.3)				X	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected surface fault ruptures.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Foundation Configuration

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Overturning	The ratio of the least horizontal dimension of the seismic-force-resisting system at the foundation level to the building height (base/height) is greater than 0.6Sa. (Tier 2: Sec. 5.4.3.3; Commentary: Sec. A.6.2.1)	X				Walls are relatively short and long in most zones.
Ties Between Foundation Elements	The foundation has ties adequate to resist seismic forces where footings, piles, and piers are not restrained by beams, slabs, or soils classified as Site Class A, B, or C. (Tier 2: Sec. 5.4.3.4; Commentary: Sec. A.6.2.2)			X		Site Class C.

17-6 Collapse Prevention Structural Checklist for Building Type W2

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low and Moderate Seismicity

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Redundancy	The number of lines of shear walls in each principal direction is greater than or equal to 2. (Tier 2: Sec. 5.5.1.1; Commentary: Sec. A.3.2.1.1)	X				Walls surround each major space.
Shear Stress Check	The shear stress in the shear walls, calculated using the Quick Check procedure of Section 4.4.3.3, is less than the following values: Structural panel sheathing – 1,000 lb/ft; Diagonal sheathing – 700 lb/ft; Straight sheathing – 100 lb/ft; All other conditions – 100 lb/ft. (Tier 2: Sec. 5.5.3.1.1; Commentary: Sec. A.3.2.7.1)		X			The central portion of the building is large, but relies primarily on perimeter shear walls. Intermediate walls or frames may be needed at the building interior. Further investigation should be performed. Lateral system strengthening or addition of new shear walls may be appropriate to mitigate seismic risk.
Stucco (Exterior Plaster) Shear Walls	Multi-story buildings do not rely on exterior stucco walls as the primary seismic-force-resisting system. (Tier 2: Sec. 5.5.3.6.1; Commentary: Sec. A.3.2.7.2)	X				No stucco noted.
Gypsum Wallboard or Plaster Shear Walls	Interior plaster or gypsum wallboard is not used for shear walls on buildings more than one story high with the exception of the uppermost level of a multi-story building. (Tier 2: Sec. 5.5.3.6.1; Commentary: Sec. A.3.2.7.3)	X				Walls appear to have plywood at most locations.
Narrow Wood Shear Walls	Narrow wood shear walls with an aspect ratio greater than 2-to-1 are not used to resist seismic forces. (Tier 2: Sec. 5.5.3.6.1; Commentary: Sec. A.3.2.7.4)	X				Walls are generally long segments.
Walls Connected Through Floors	Shear walls have an interconnection between stories to transfer overturning and shear forces through the floor. (Tier 2: Sec. 5.5.3.6.2; Commentary: Sec. A.3.2.7.5)			X		Single story building.
Hillside Site	For structures that are taller on at least one side by more than one-half story because of a sloping site, all shear walls on the downhill slope have an aspect ratio less than 1-to-1. (Tier 2: Sec. 5.5.3.6.3; Commentary: Sec. A.3.2.7.6)			X		Footprint of the building is generally flat.

Cripple Walls	Cripple walls below first-floor-level shear walls are braced to the foundation with wood structural panels. (Tier 2: Sec. 5.5.3.6.4; Commentary: Sec. A.3.2.7.7)			X		Wall rest directly on foundation.
Openings	Walls with openings greater than 80% of the length are braced with wood structural panel shear walls with aspect ratios of not more than 1.5-to-1 or are supported by adjacent construction through positive ties capable of transferring the seismic forces. (Tier 2: Sec. 5.5.3.6.5; Commentary: Sec. A.3.2.7.8)	X				Segments between windows are still quite long (30-foot sections are common).

Connections

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Wood Posts	There is a positive connection of wood posts to the foundation. (Tier 2: Sec. 5.7.3.3; Commentary: Sec. A.5.3.3)			X		Where posts are used, connections a
Wood Sills	All wood sills are bolted to the foundation. (Tier 2: Sec. 5.7.3.3; Commentary: Sec. A.5.3.4)	X				Bolts are indicated at typical locations.
Girder-Column Connection	There is a positive connection using plates, connection hardware, or straps between the girder and the column support. (Tier 2: Sec. 5.7.4.1; Commentary: Sec. A.5.4.1)	X				Bolted caps are called out for interior posts.

High Seismicity (Complete the Following Items in Addition to the Items for Low & Moderate Seismicity)

Connections

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Wood Sill Bolts	Sill bolts are spaced at 6 ft (1.8 m) or less with acceptable edge and end distance provided for wood and concrete. (Tier 2: Sec. 5.7.3.3; Commentary: Sec. A.5.3.7)	X				2-foot spacing is called out in the record drawings.

Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Diaphragm Continuity	The diaphragms are not composed of split-level floors and do not have expansion joints. (Tier 2: Sec. 5.6.1.1; Commentary: Sec. A.4.1.1)	X				Most diaphragm elements are at a single elevations.
Roof Chord Continuity	All chord elements are continuous, regardless of changes in roof elevation. (Tier 2: Sec. 5.6.1.1; Commentary: Sec. A.4.1.3)	X				Wall elements with beams at openings appear to serve as chords.
Diaphragm Reinforcement at Openings	There is reinforcing around all diaphragm openings larger than 50% of the building width in either major plan dimension. (Tier 2: Sec. 5.6.1.5; Commentary: Sec. A.4.1.8)			X		Openings are generally small.
Straight Sheathing	All straight-sheathed diaphragms have aspect ratios less than 2-to-1 in the direction being considered. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.1)			X		Plywood sheathing used.

Spans	All wood diaphragms with spans greater than 24 ft (7.3 m) consist of wood structural panels or diagonal sheathing. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.2)	X				Plywood sheathing used.
Diagonally Sheathed and Unblocked Diaphragms	All diagonally sheathed or unblocked wood structural panel diaphragms have horizontal spans less than 40 ft (12.2 m) and have aspect ratios less than or equal to 4-to-1. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.3)		X			The center of the building appears to be unsupported, requiring the diaphragm to span most of the building's width. Additional interior shear walls may be required. Further investigation should be performed. Diaphragm reinforcement may be appropriate to mitigate seismic risk.
Other Diaphragms	The diaphragms do not consist of a system other than wood, metal deck, concrete, or horizontal bracing. (Tier 2: Sec. 5.6.5; Commentary: Sec. A.4.7.1)	X				Plywood shear walls are typical.

Port Angeles, Roosevelt Elementary School, Main Building

17-38 Nonstructural Checklist

Notes:

C = Compliant, NC = Noncompliant, N/A = Not Applicable, and U = Unknown.

Performance Level: HR = Hazards Reduced, LS = Life Safety, and PR = Position Retention.

Level of Seismicity: L = Low, M = Moderate, and H = High

Life Safety Systems

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping is anchored and braced in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.1)		X			No available record drawing information on fire suppression piping and unable to verify during site investigation. Based on age of the building, it is assumed that seismic bracing for fire suppression piping do not comply with NFPA 13. Bracing for fire suppression piping may be appropriate to mitigate seismic risk.
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping has flexible couplings in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.2)		X			No available record drawing information on fire suppression piping and unable to verify during site investigation. Based on age of the building, it is assumed the flexible couplings on the fire suppression piping do not comply with NFPA 13. Flexible coupling for fire suppression piping may be appropriate to mitigate seismic risk.
LSS-3 Emergency Power. HR-not required; LS-LMH; PR-LMH.	Equipment used to power or control Life Safety systems is anchored or braced. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.1)			X		Emergency systems not observed.
LSS-4 Stair and Smoke Ducts. HR-not required; LS-LMH; PR-LMH.	Stair pressurization and smoke control ducts are braced and have flexible connections at seismic joints. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.1)			X		No stairs.

LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR-MH.	Penetrations through panelized ceilings for fire suppression devices provide clearances in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.3)				X	No available record drawing information on sprinkle head clearance and unable to verify during site investigation. Evaluation of penetrations may be appropriate to mitigate seismic risk.
LSS-6 Emergency Lighting. HR-not required; LS-not required; PR-LMH	Emergency and egress lighting equipment is anchored or braced. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.1)			X		Not required for life safety performance level.

Hazardous Materials

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
HM-1 Hazardous Material Equipment. HR-LMH; LS-LMH; PR-LMH.	Equipment mounted on vibration isolators and containing hazardous material is equipped with restraints or snubbers. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.2)			X		No hazardous material equipment observed.
HM-2 Hazardous Material Storage. HR-LMH; LS-LMH; PR-LMH.	Breakable containers that hold hazardous material, including gas cylinders, are restrained by latched doors, shelf lips, wires, or other methods. (Tier 2: Sec. 13.8.3; Commentary: Sec. A.7.15.1)		X			Equipment room bottles stored on shelf with no restraint. Restraining breakable containers that hold hazardous material by latched doors, shelf lips, wires, or other methods may be appropriate to mitigate seismic risk.
HM-3 Hazardous Material Distribution. HR-MH; LS-MH; PR-MH.	Piping or ductwork conveying hazardous materials is braced or otherwise protected from damage that would allow hazardous material release. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)		X			No bracing on gas piping noted. Bracing and anchoring of gas piping may be appropriate to mitigate seismic risk.
HM-4 Shutoff Valves. HR-MH; LS-MH; PR-MH.	Piping containing hazardous material, including natural gas, has shutoff valves or other devices to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.3)				X	No shut-off was observed. Further investigation of mechanical piping should be performed. Providing shutoff valves may be appropriate to mitigate seismic risk.
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Hazardous material ductwork and piping, including natural gas piping, have flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.15.4)		X			Only hard couplings noted. Flexible couplings may be appropriate to mitigate seismic risk.

HM-6 Piping or Ducts Crossing Seismic Joints. HR-MH; LS-MH; PR-MH.	Piping or ductwork carrying hazardous material that either crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5, 13.7.6; Commentary: Sec. A.7.13.6)			X		The building does not appear to contain seismic joints, isolation planes, or independent structures.
--	--	--	--	---	--	--

Partitions

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
P-1 Unreinforced Masonry. HR-LMH; LS-LMH; PR-LMH.	Unreinforced masonry or hollow-clay tile partitions are braced at a spacing of at most 10 ft (3.0 m) in Low or Moderate Seismicity, or at most 6 ft (1.8 m) in High Seismicity. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.1)			X		No unreinforced masonry.
P-2 Heavy Partitions Supported by Ceilings. HR-LMH; LS-LMH; PR-LMH.	The tops of masonry or hollow-clay tile partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Does not appear that there are heavy partitions.
P-3 Drift. HR-not required; LS-MH; PR-MH.	Rigid cementitious partitions are detailed to accommodate the following drift ratios: in steel moment frame, concrete moment frame, and wood frame buildings, 0.02; in other buildings, 0.005. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.2)			X		No cementitious partitions.
P-4 Light Partitions Supported by Ceilings. HR-not required; LS-not required; PR-MH.	The tops of gypsum board partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Not required for life safety performance level.
P-5 Structural Separations. HR-not required; LS-not required; PR-MH.	Partitions that cross structural separations have seismic or control joints. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.3)			X		Not required for life safety performance level.
P-6 Tops. HR-not required; LS-not required; PR-MH.	The tops of ceiling-high framed or panelized partitions have lateral bracing to the structure at a spacing equal to or less than 6 ft (1.8 m). (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.4)			X		Not required for life safety performance level.

Ceilings

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
C-1 Suspended Lath and Plaster. HR-H; LS-MH; PR-LMH.	Suspended lath and plaster ceilings have attachments that resist seismic forces for every 12 ft ² (1.1 m ²) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		No lathe and plaster.
C-2 Suspended Gypsum Board. HR-not required; LS-MH; PR-LMH.	Suspended gypsum board ceilings have attachments that resist seismic forces for every 12 ft ² (1.1 m ²) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		No suspended gypboard noted.

C-3 Integrated Ceilings. HR-not required; LS-not required; PR-MH.	Integrated suspended ceilings with continuous areas greater than 144 ft ² (13.4 m ²) and ceilings of smaller areas that are not surrounded by restraining partitions are laterally restrained at a spacing no greater than 12 ft (3.6 m) with members attached to the structure above. Each restraint location has a minimum of four diagonal wires and compression struts, or diagonal members capable of resisting compression. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.2)			X		Not required for life safety performance level.
C-4 Edge Clearance. HR-not required; LS-not required; PR-MH.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft ² (13.4 m ²) have clearances from the enclosing wall or partition of at least the following: in Moderate Seismicity, 1/2 in. (13 mm); in High Seismicity, 3/4 in. (19 mm). (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.4)			X		Not required for life safety performance level.
C-5 Continuity Across Structure Joints. HR-not required; LS-not required; PR-MH.	The ceiling system does not cross any seismic joint and is not attached to multiple independent structures. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.5)			X		Not required for life safety performance level.
C-6 Edge Support. HR-not required; LS-not required; PR-H.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft ² (13.4 m ²) are supported by closure angles or channels not less than 2 in. (51 mm) wide. (Tier 2: Sec. 13.6.4 ; Commentary: Sec. A.7.2.6)			X		Not required for life safety performance level.
C-7 Seismic Joints. HR-not required; LS-not required; PR-H.	Acoustical tile or lay-in panel ceilings have seismic separation joints such that each continuous portion of the ceiling is no more than 2,500 ft ² (232.3 m ²) and has a ratio of long-to-short dimension no more than 4-to-1. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.7)			X		Not required for life safety performance level.

Light Fixtures

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
LF-1 Independent Support. HR-not required; LS-MH; PR-MH.	Light fixtures that weigh more per square foot than the ceiling they penetrate are supported independent of the grid ceiling suspension system by a minimum of two wires at diagonally opposite corners of each fixture. (Tier 2: Sec. 13.6.4, 13.7.9; Commentary: Sec. A.7.3.2)				X	It is unknown how much the light fixtures weigh. Based on the age of the building, it is unlikely that they are independently supported by the structure. Further investigation should be completed. Adding wires for suspending the light fixtures may be appropriate to mitigate seismic risk.

LF-2 Pendant Supports. HR-not required; LS-not required; PR-H.	Light fixtures on pendant supports are attached at a spacing equal to or less than 6 ft. Unbraced suspended fixtures are free to allow a 360-degree range of motion at an angle not less than 45 degrees from horizontal without contacting adjacent components. Alternatively, if rigidly supported and/or braced, they are free to move with the structure to which they are attached without damaging adjoining components. Additionally, the connection to the structure is capable of accommodating the movement without failure. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.3)			X		Not required for life safety performance level.
LF-3 Lens Covers. HR-not required; LS-not required; PR-H.	Lens covers on light fixtures are attached with safety devices. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.4)			X		Not required for life safety performance level.

Cladding and Glazing

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
CG-1 Cladding Anchors. HR-MH; LS-MH; PR-MH.	Cladding components weighing more than 10 lb/ft ² (0.48 kN/m ²) are mechanically anchored to the structure at a spacing equal to or less than the following: for Life Safety in Moderate Seismicity, 6 ft (1.8 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 ft (1.2 m) (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.1)			X		The building does not appear to have any cladding components.
CG-2 Cladding Isolation. HR-not required; LS-MH; PR-MH.	For steel or concrete moment-frame buildings, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.3)			X		No cladding panels.
CG-3 Multi-Story Panels. HR-MH; LS-MH; PR-MH.	For multi-story panels attached at more than one floor level, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.4)			X		No cladding panels.

CG-4 Threaded Rods. HR-not required; LS-MH; PR-MH.	Threaded rods for panel connections detailed to accommodate drift by bending of the rod have a length-to-diameter ratio greater than 0.06 times the story height in inches for Life Safety in Moderate Seismicity and 0.12 times the story height in inches for Life Safety in High Seismicity and Position Retention in any seismicity. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.9)			X		No cladding panels.
CG-5 Panel Connections. HR-MH; LS-MH; PR-MH.	Cladding panels are anchored out of plane with a minimum number of connections for each wall panel, as follows: for Life Safety in Moderate Seismicity, 2 connections; for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 connections. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.5)			X		No cladding panels.
CG-6 Bearing Connections. HR-MH; LS-MH; PR-MH.	Where bearing connections are used, there is a minimum of two bearing connections for each cladding panel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.6)			X		No cladding panels.
CG-7 Inserts. HR-MH; LS-MH; PR-MH.	Where concrete cladding components use inserts, the inserts have positive anchorage or are anchored to reinforcing steel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.7)			X		No cladding panels.
CG-8 Overhead Glazing. HR-not required; LS-MH; PR-MH.	Glazing panes of any size in curtain walls and individual interior or exterior panes more than 16 ft ² (1.5 m ²) in area are laminated annealed or laminated heat-strengthened glass and are detailed to remain in the frame when cracked. (Tier 2: Sec. 13.6.1.5; Commentary: Sec. A.7.4.8)				X	Glazing type not known.

Masonry Veneer

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
M-1 Ties. HR-not required; LS-LMH; PR-LMH.	Masonry veneer is connected to the backup with corrosion-resistant ties. There is a minimum of one tie for every 2-2/3 ft ² (0.25 m ²), and the ties have spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 36 in. (914 mm); for Life Safety in High Seismicity and for Position Retention in any seismicity, 24 in. (610 mm). (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.1)				X	No ties are indicated in the drawings, and this cannot be observed. Further investigation should be completed. Adding connections for the veneer may be appropriate to mitigate seismic risk.
M-2 Shelf Angles. HR-not required; LS-LMH; PR-LMH.	Masonry veneer is supported by shelf angles or other elements at each floor above the ground floor. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.2)	X				Shelf angles indicated at high roof locations.

M-3 Weakened Planes. HR-not required; LS-LMH; PR-LMH.	Masonry veneer is anchored to the backup adjacent to weakened planes, such as at the locations of flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.3)				X	No ties are indicated in the drawings, and this cannot be observed. Further investigation should be completed. Adding connections for the veneer may be appropriate to mitigate seismic risk.
M-4 Unreinforced Masonry Backup. HR-LMH; LS-LMH; PR-LMH.	There is no unreinforced masonry backup. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.2)	X				No unreinforced masonry present. Reinforced CMU back-up typical.
M-5 Stud Tracks. HR-not required; LS-MH; PR-MH.	For veneer with coldformed steel stud backup, stud tracks are fastened to the structure at a spacing equal to or less than 24 in. (610 mm) on center. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.)			X		No light-gauge present. Reinforced CMU back-up typical.
M-6 Anchorage. HR-not required; LS-MH; PR-MH.	For veneer with concrete block or masonry backup, the backup is positively anchored to the structure at a horizontal spacing equal to or less than 4 ft along the floors and roof. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.1)				X	No ties are indicated in the drawings, and this cannot be observed. Further investigation should be completed. Adding connections for the veneer may be appropriate to mitigate seismic risk.
M-7 Weep Holes. HR-not required; LS-not required; PR-MH.	In veneer anchored to stud walls, the veneer has functioning weep holes and base flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.6)			X		Not required for life safety performance level.
M-8 Openings. HR-not required; LS-not required; PR-MH.	For veneer with cold-formed-steel stud backup, steel studs frame window and door openings. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.2)			X		Not required for life safety performance level.

Parapets, Cornices, Ornamentation, and Appendages

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
PCOA-1 URM Parapets or Cornices. HR-LMH; LS-LMH; PR-LMH.	Laterally unsupported unreinforced masonry parapets or cornices have height-to-thickness ratios no greater than the following: for Life Safety in Low or Moderate Seismicity, 2.5; for Life Safety in High Seismicity and for Position Retention in any seismicity, 1.5. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.1)	X				Parapets are minor per record drawings.
PCOA-2 Canopies. HR-not required; LS-LMH; PR-LMH.	Canopies at building exits are anchored to the structure at a spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 10 ft (3.0 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 6 ft (1.8 m). (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.2)			X		No canopies.

PCOA-3 Concrete Parapets. HR-H; LS-MH; PR-LMH.	Concrete parapets with height-to-thickness ratios greater than 2.5 have vertical reinforcement. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.3)			X		No concrete parapets.
PCOA-4 Appendages. HR-MH; LS-MH; PR-LMH.	Cornices, parapets, signs, and other ornamentation or appendages that extend above the highest point of anchorage to the structure or cantilever from components are reinforced and anchored to the structural system at a spacing equal to or less than 6 ft (1.8 m). This evaluation statement item does not apply to parapets or cornices covered by other evaluation statements. (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.4)			X		No ornamentation not covered in previous comments.

Masonry Chimneys

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
MC-1 URM Chimneys. HR-LMH; LS-LMH; PR-LMH.	Unreinforced masonry chimneys extend above the roof surface no more than the following: for Life Safety in Low or Moderate Seismicity, 3 times the least dimension of the chimney; for Life Safety in High Seismicity and for Position Retention in any seismicity, 2 times the least dimension of the chimney. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.1)			X		No chimney.
MC-2 Anchorage. HR-LMH; LS-LMH; PR-LMH.	Masonry chimneys are anchored at each floor level, at the topmost ceiling level, and at the roof. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.2)			X		There are no masonry chimneys.

Stairs

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
S-1 Stair Enclosures. HR-not required; LS-LMH; PR-LMH.	Hollow-clay tile or unreinforced masonry walls around stair enclosures are restrained out of plane and have height-to-thickness ratios not greater than the following: for Life Safety in Low or Moderate Seismicity, 15-to-1; for Life Safety in High Seismicity and for Position Retention in any seismicity, 12-to-1. (Tier 2: Sec. 13.6.2, 13.6.8; Commentary: Sec. A.7.10.1)			X		No unreinforced masonry.
S-2 Stair Details. HR-not required; LS-LMH; PR-LMH.	The connection between the stairs and the structure does not rely on post-installed anchors in concrete or masonry, and the stair details are capable of accommodating the drift calculated using the Quick Check procedure of Section 4.4.3.1 for moment-frame structures or 0.5 in. for all other structures without including any lateral stiffness contribution from the stairs. (Tier 2: Sec. 13.6.8; Commentary: Sec. A.7.10.2)			X		One-story building, only mechanical loft access above.

Contents and Furnishings

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
CF-1 Industrial Storage Racks. HR-LMH; LS-MH; PR-MH.	Industrial storage racks or pallet racks more than 12 ft high meet the requirements of ANSI/RMI MH 16.1 as modified by ASCE 7, Chapter 15. (Tier 2: Sec. 13.8.1; Commentary: Sec. A.7.11.1)		X			Tall racks adjacent to the locker rooms did not appear to be anchored.
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Contents more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 are anchored to the structure or to each other. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.2)	X				Shelving was generally integral or anchored.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Equipment, stored items, or other contents weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level are braced or otherwise restrained. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.3)		X			Items on high shelving in mechanical room, classroom in former shop areas, janitors' closet, and in storage room near lockers.
CF-4 Access Floors. HR-not required; LS-not required; PR-MH.	Access floors more than 9 in. (229 mm) high are braced. (Tier 2: Sec. 13.6.10; Commentary: Sec. A.7.11.4)			X		Not required for life safety performance level.
CF-5 Equipment on Access Floors. HR-not required; LS-not required; PR-MH.	Equipment and other contents supported by access floor systems are anchored or braced to the structure independent of the access floor. (Tier 2: Sec. 13.7.7 13.6.10; Commentary: Sec. A.7.11.5)			X		Not required for life safety performance level.
CF-6 Suspended Contents. HR-not required; LS-not required; PR-H.	Items suspended without lateral bracing are free to swing from or move with the structure from which they are suspended without damaging themselves or adjoining components. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.6)			X		Not required for life safety performance level.

Mechanical and Electrical Equipment

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
ME-1 Fall-Prone Equipment. HR-not required; LS-H; PR-H.	Equipment weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level, and which is not in-line equipment, is braced. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.4)		X			Mechanical room equipment generally not braced. Bracing or anchoring of equipment may be appropriate to mitigate seismic risk.
ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Equipment installed in line with a duct or piping system, with an operating weight more than 75 lb (34.0 kg), is supported and laterally braced independent of the duct or piping system. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.5)		X			Isolated non-braced ceiling hung equipment at mechanical room. Bracing or anchoring of equipment may be appropriate to mitigate seismic risk.

ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Equipment more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 is anchored to the floor slab or adjacent structural walls. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.6)				X	Not able to verify during site investigation. Further investigation should be performed. Brace tops of equipment taller than 6 feet to nearest backing wall or provide overturning base restraint.
ME-4 Mechanical Doors. HR-not required; LS-not required; PR-MH.	Mechanically operated doors are detailed to operate at a story drift ratio of 0.01. (Tier 2: Sec. 13.6.9; Commentary: Sec. A.7.12.7)			X		Not required for life safety performance level.
ME-5 Suspended Equipment. HR-not required; LS-not required; PR-H.	Equipment suspended without lateral bracing is free to swing from or move with the structure from which it is suspended without damaging itself or adjoining components. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.8)			X		Not required for life safety performance level.
ME-6 Vibration Isolators. HR-not required; LS-not required; PR-H.	Equipment mounted on vibration isolators is equipped with horizontal restraints or snubbers and with vertical restraints to resist overturning. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.9)			X		Not required for life safety performance level.
ME-7 Heavy Equipment. HR-not required; LS-not required; PR-H.	Floor supported or platform-supported equipment weighing more than 400 lb (181.4 kg) is anchored to the structure. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.10)			X		Not required for life safety performance level.
ME-8 Electrical Equipment. HR-not required; LS-not required; PR-H.	Electrical equipment is laterally braced to the structure. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.11)			X		Not required for life safety performance level.
ME-9 Conduit Couplings. HR-not required; LS-not required; PR-H.	Conduit greater than 2.5 in. (64 mm) trade size that is attached to panels, cabinets, or other equipment and is subject to relative seismic displacement has flexible couplings or connections. (Tier 2: Sec. 13.7.8; Commentary: Sec. A.7.12.12)			X		Not required for life safety performance level.

Piping

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
PP-1 Flexible Couplings. HR-not required; LS-not required; PR-H.	Fluid and gas piping has flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.2)			X		Not required for life safety performance level.
PP-2 Fluid and Gas Piping. HR-not required; LS-not required; PR-H.	Fluid and gas piping is anchored and braced to the structure to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		Not required for life safety performance level.
PP-3 C-Clamps. HR-not required; LS-not required; PR-H.	One-sided C-clamps that support piping larger than 2.5 in. (64 mm) in diameter are restrained. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.5)			X		Not required for life safety performance level.

PP-4 Piping Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Piping that crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.6)			X		Not required for life safety performance level.
--	---	--	--	---	--	---

Ducts

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
D-1 Duct Bracing. HR-not required; LS-not required; PR-H.	Rectangular ductwork larger than 6 ft ² (0.56 m ²) in cross-sectional area and round ducts larger than 28 in. (711 mm) in diameter are braced. The maximum spacing of transverse bracing does not exceed 30 ft (9.2 m). The maximum spacing of longitudinal bracing does not exceed 60 ft (18.3 m). (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.2)			X		Not required for life safety performance level.
D-2 Duct Support. HR-not required; LS-not required; PR-H.	Ducts are not supported by piping or electrical conduit. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.3)			X		Not required for life safety performance level.
D-3 Ducts Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Ducts that cross seismic joints or isolation planes or are connected to independent structures have couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.4)			X		Not required for life safety performance level.

Elevators


EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
EL-1 Retainer Guards. HR-not required; LS-H; PR-H.	Sheaves and drums have cable retainer guards. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.1)			X		No elevator.
EL-2 Retainer Plate. HR-not required; LS-H; PR-H.	A retainer plate is present at the top and bottom of both car and counterweight. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.2)			X		No elevator.
EL-3 Elevator Equipment. HR-not required; LS-not required; PR-H.	Equipment, piping, and other components that are part of the elevator system are anchored. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.3)			X		Not required for life safety performance level.
EL-4 Seismic Switch. HR-not required; LS-not required; PR-H.	Elevators capable of operating at speeds of 150 ft/min or faster are equipped with seismic switches that meet the requirements of ASME A17.1 or have trigger levels set to 20% of the acceleration of gravity at the base of the structure and 50% of the acceleration of gravity in other locations. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.4)			X		Not required for life safety performance level.
EL-5 Shaft Walls. HR-not required; LS-not required; PR-H.	Elevator shaft walls are anchored and reinforced to prevent toppling into the shaft during strong shaking. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.5)			X		Not required for life safety performance level.

EL-6 Counterweight Rails. HR-not required; LS-not required; PR-H.	All counterweight rails and divider beams are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.6)			X		Not required for life safety performance level.
EL-7 Brackets. HR-not required; LS-not required; PR-H.	The brackets that tie the car rails and the counterweight rail to the structure are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.7)			X		Not required for life safety performance level.
EL-8 Spreader Bracket. HR-not required; LS-not required; PR-H.	Spreader brackets are not used to resist seismic forces. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.8)			X		Not required for life safety performance level.
EL-9 Go-Slow Elevators. HR-not required; LS-not required; PR-H.	The building has a go-slow elevator system. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.9)			X		Not required for life safety performance level.

FEMA E-74 Nonstructural Seismic Bracing Excerpts

This page intentionally left blank.

Life Safety Systems

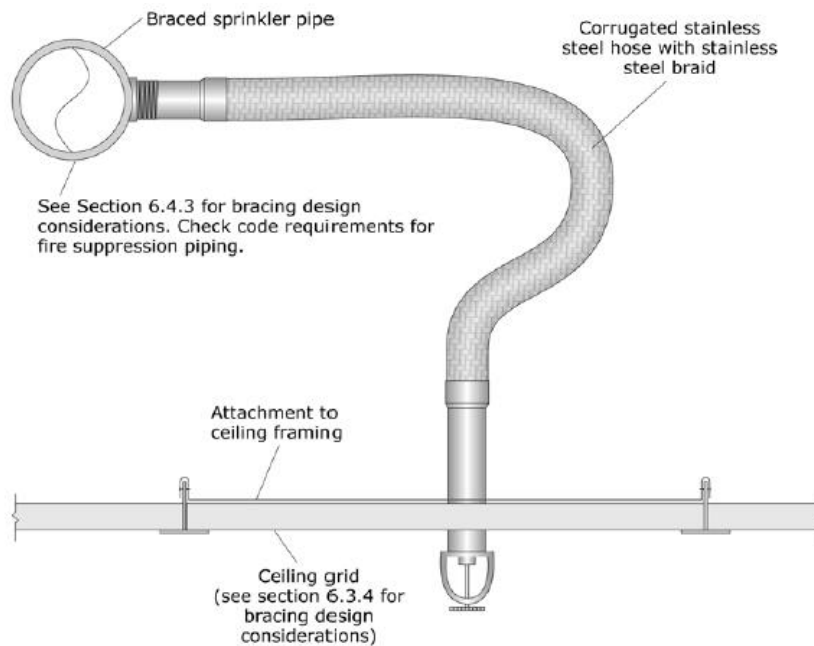

Note: for seismic design category D, E & F, the flexible sprinkler hose fitting must accommodate at least 1" of ceiling movement without use of an oversized opening. Alternatively, the sprinkler head must have a 2" oversize ring or adapter that allows 1" movement in all directions.

Figure G-1. Flexible Sprinkler Drop.

(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

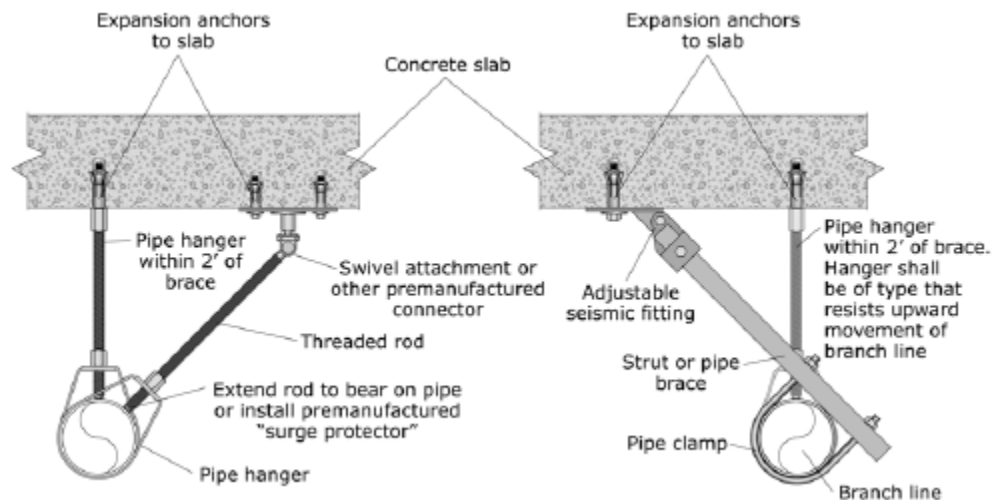


Figure G-2. End of Line Restraint.

(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

Partitions

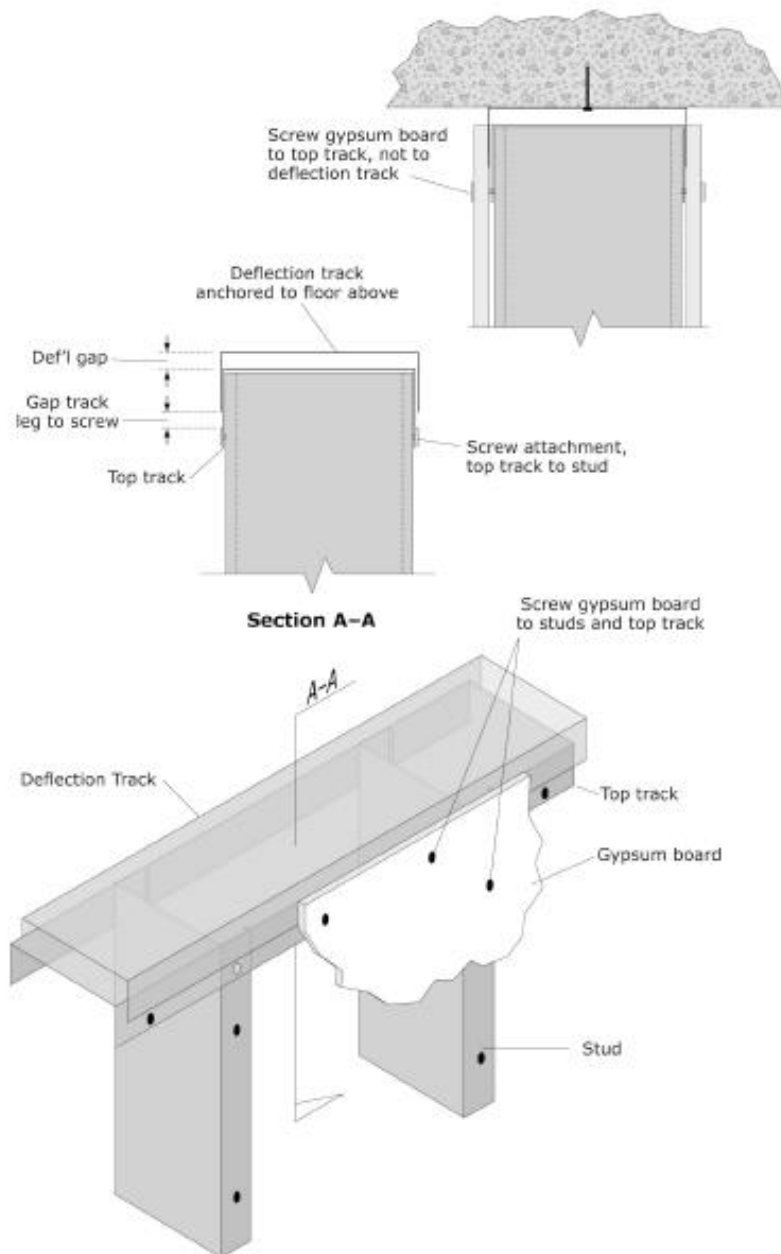


Figure G-3. Mitigation Schemes for Bracing the Tops of Metal Stud Partitions Walls.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

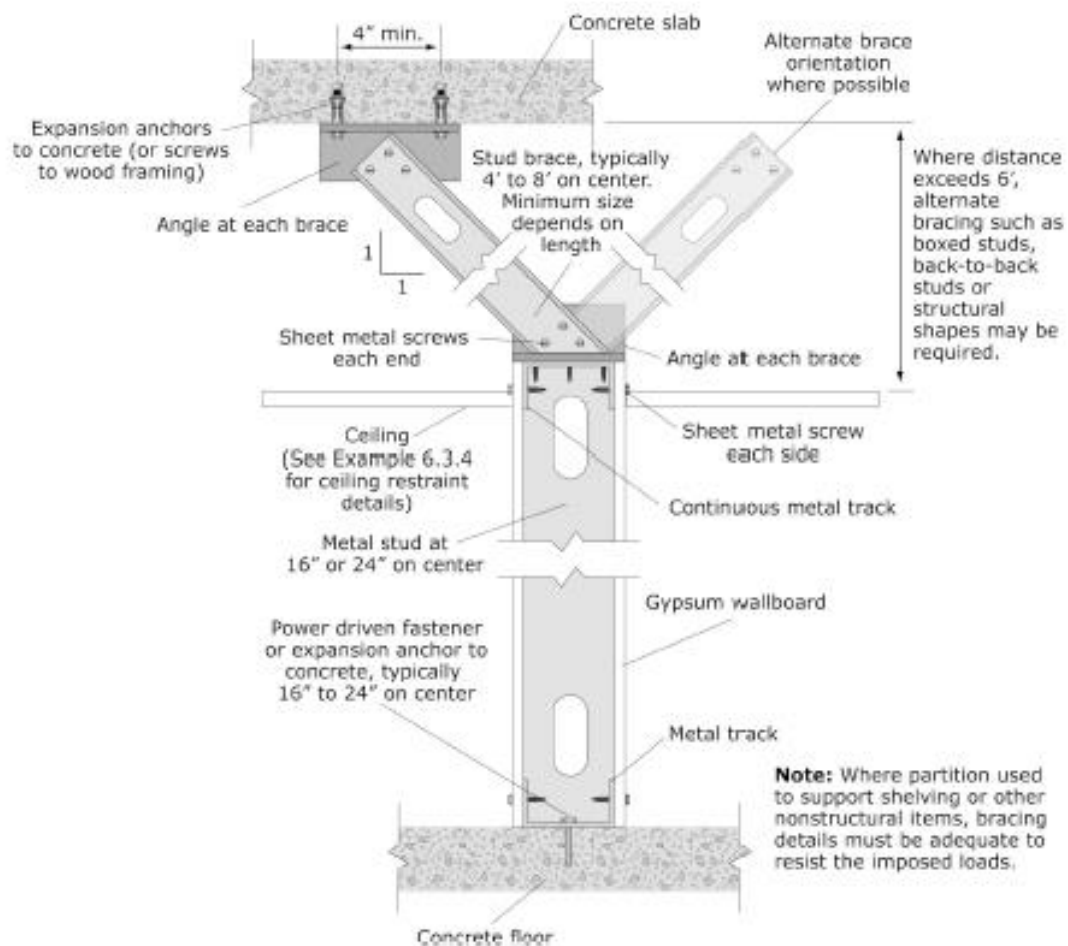


Figure G-4. Mitigation Schemes for Bracing the Tops of Metal Stud Partition Walls.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

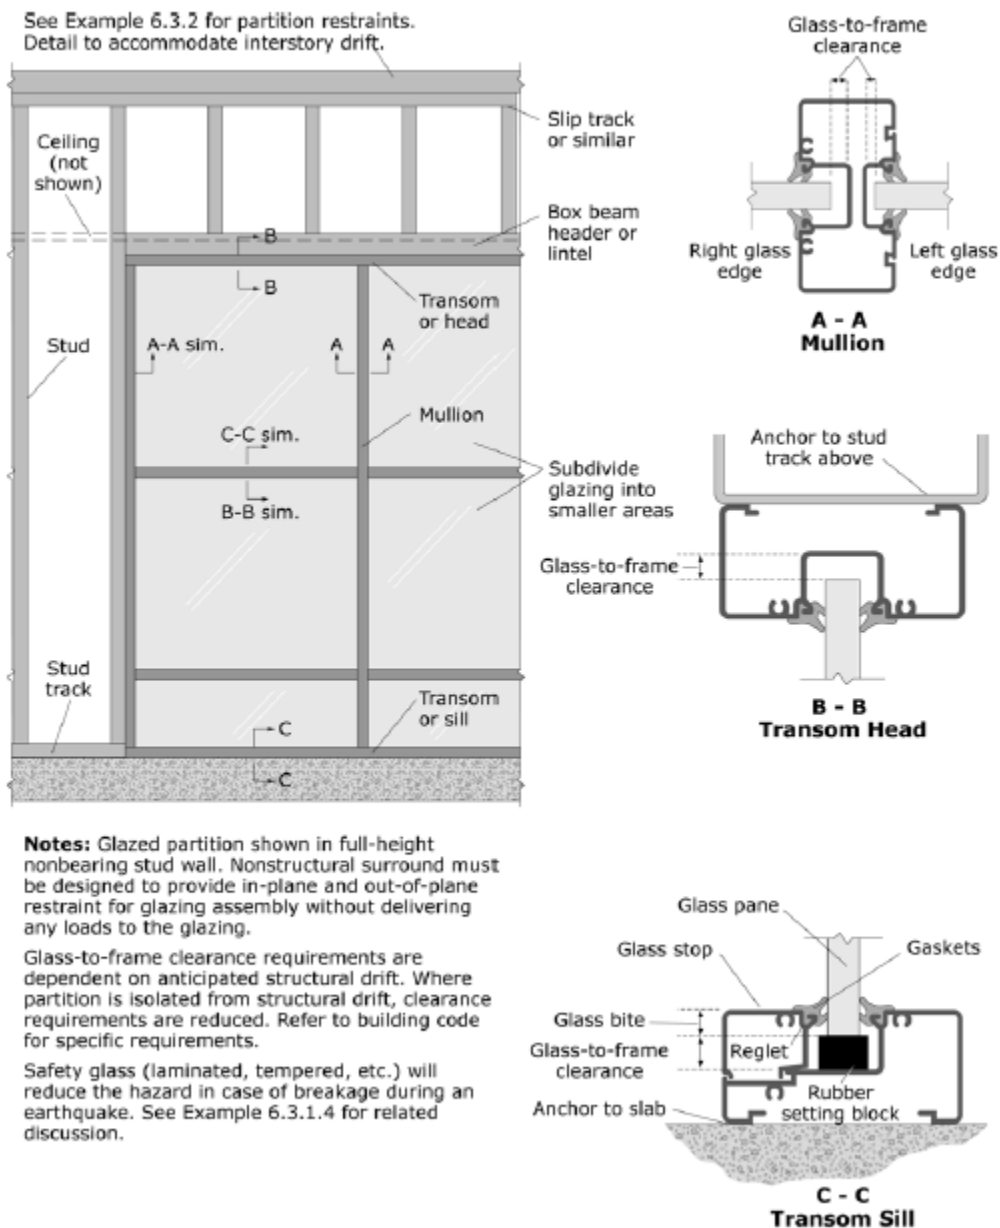


Figure G-5. Full-height Glazed Partition.

(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

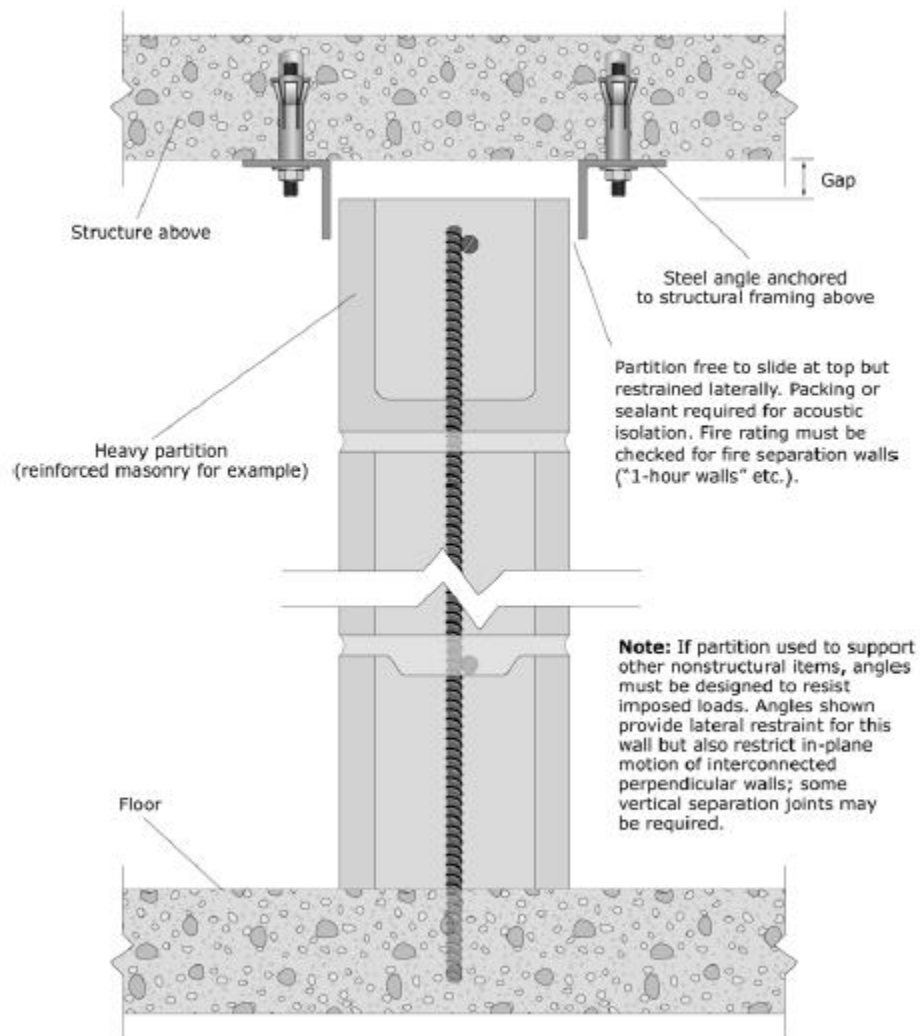


Figure G-6. Full-height Heavy Partition.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

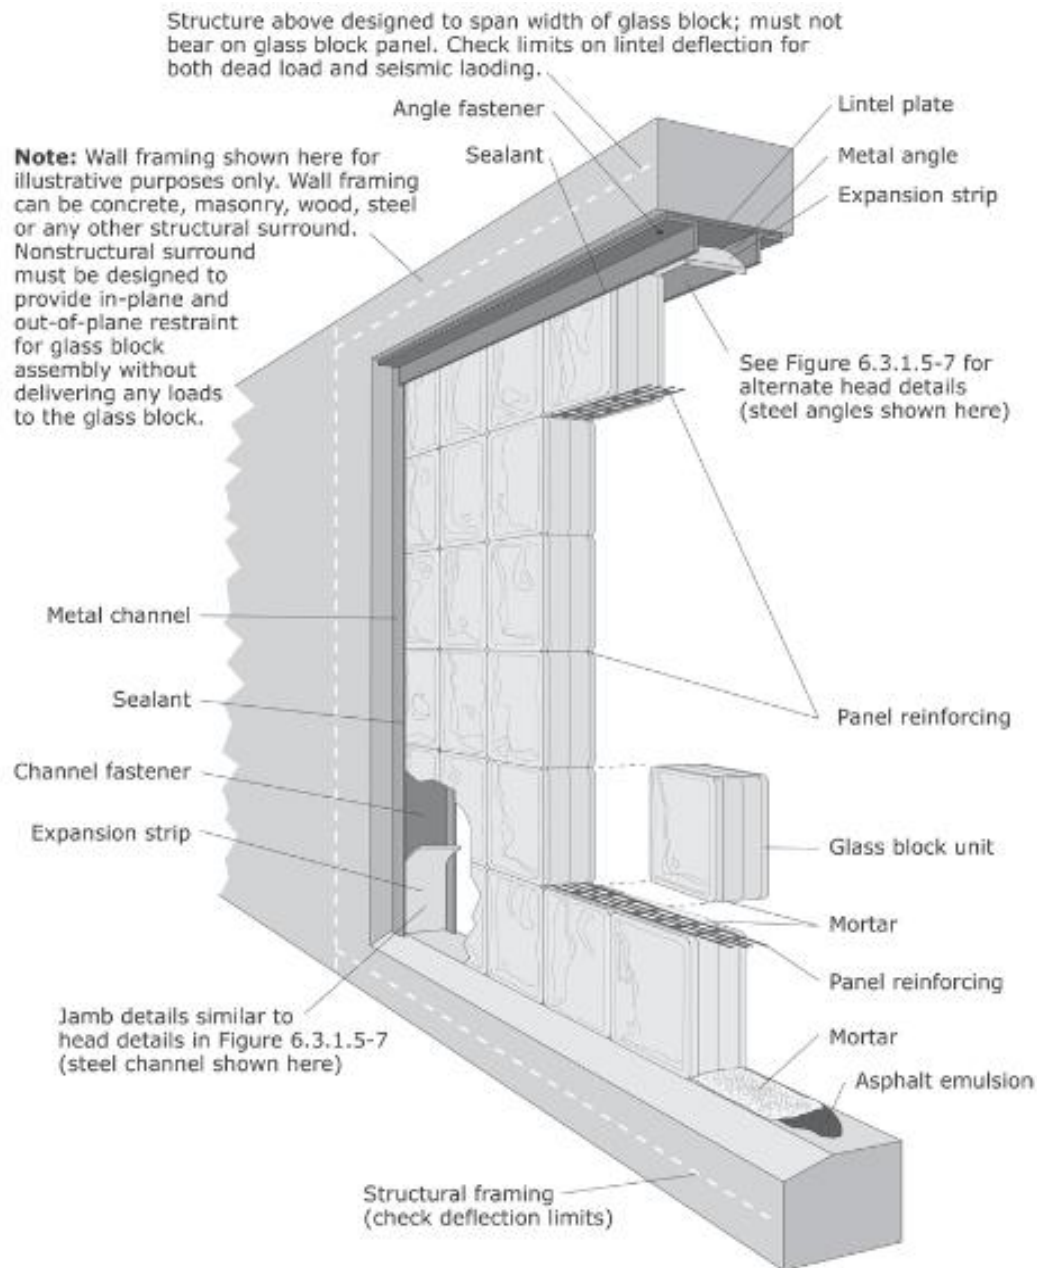


Figure G-7. Typical Glass Block Panel Details.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Ceilings


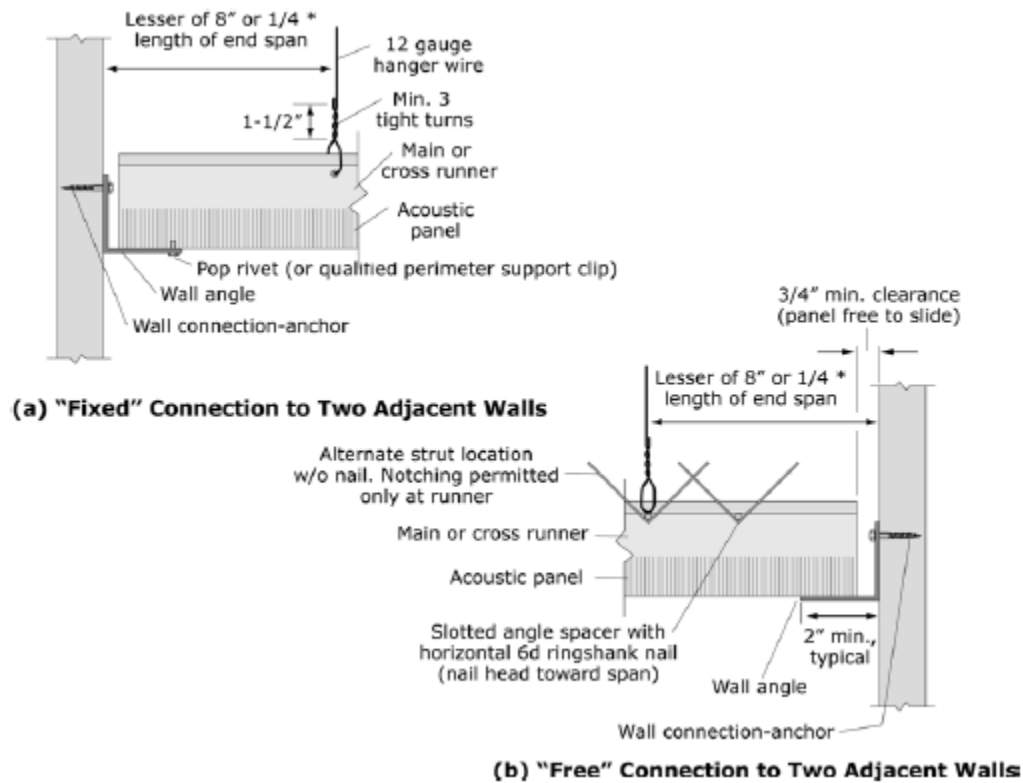


Figure G-8. Suspension System for Acoustic Lay-in Panel Ceilings – Edge Conditions.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

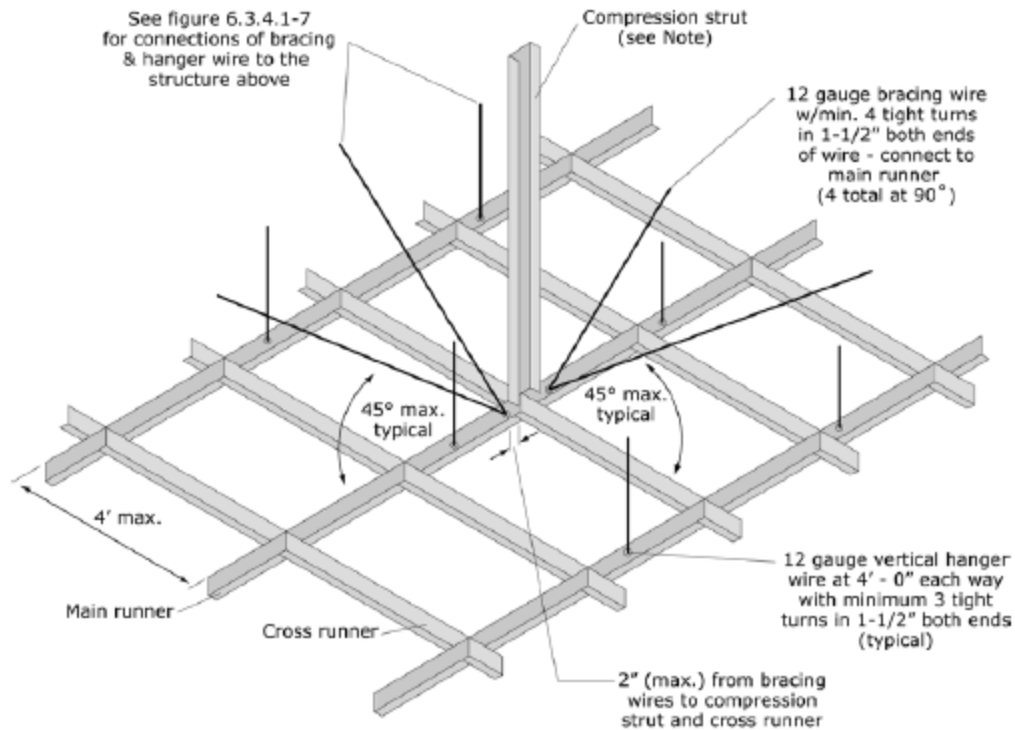

Note: Compression strut shall not replace hanger wire. Compression strut consists of a steel section attached to main runner with 2 - #12 sheet metal screws and to structure with 2 - #12 screws to wood or 1/4" min. expansion anchor to structure. Size of strut is dependent on distance between ceiling and structure ($l/r \leq 200$). A 1" diameter conduit can be used for up to 6'; a 1-5/8" X 1-1/4" metal stud can be used for up to 10'

Per DSA IR 25-5, ceiling areas less than 144 sq. ft. or fire rated ceilings less than 96 sq. ft., surrounded by walls braced to the structure above do not require lateral bracing assemblies when they are attached to two adjacent walls. (ASTM E580 does not require lateral bracing assemblies for ceilings less than 1000 sq. ft.; see text.)

Figure G-9. Suspension System for Acoustic Lay-in Panel Ceilings – General Bracing Assembly.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

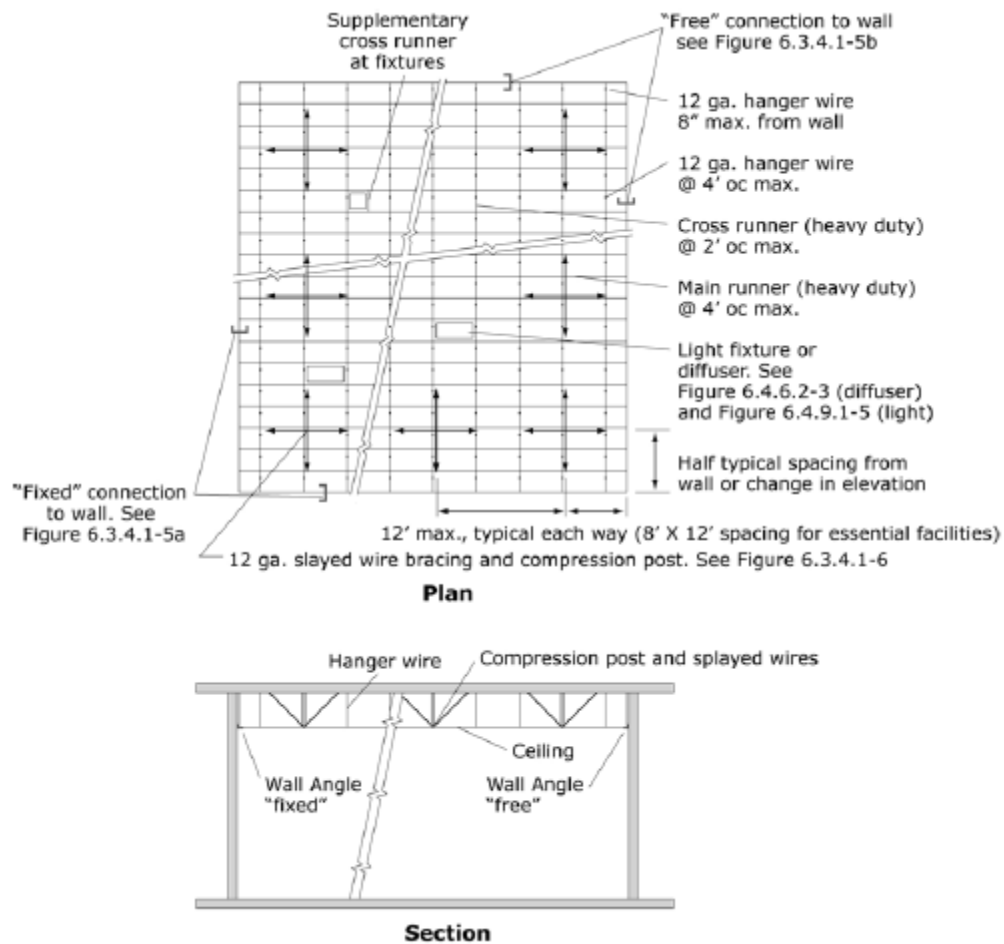


Figure G-10. Suspension System for Acoustic Lay-in Panel Ceilings – General Bracing Layout.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)



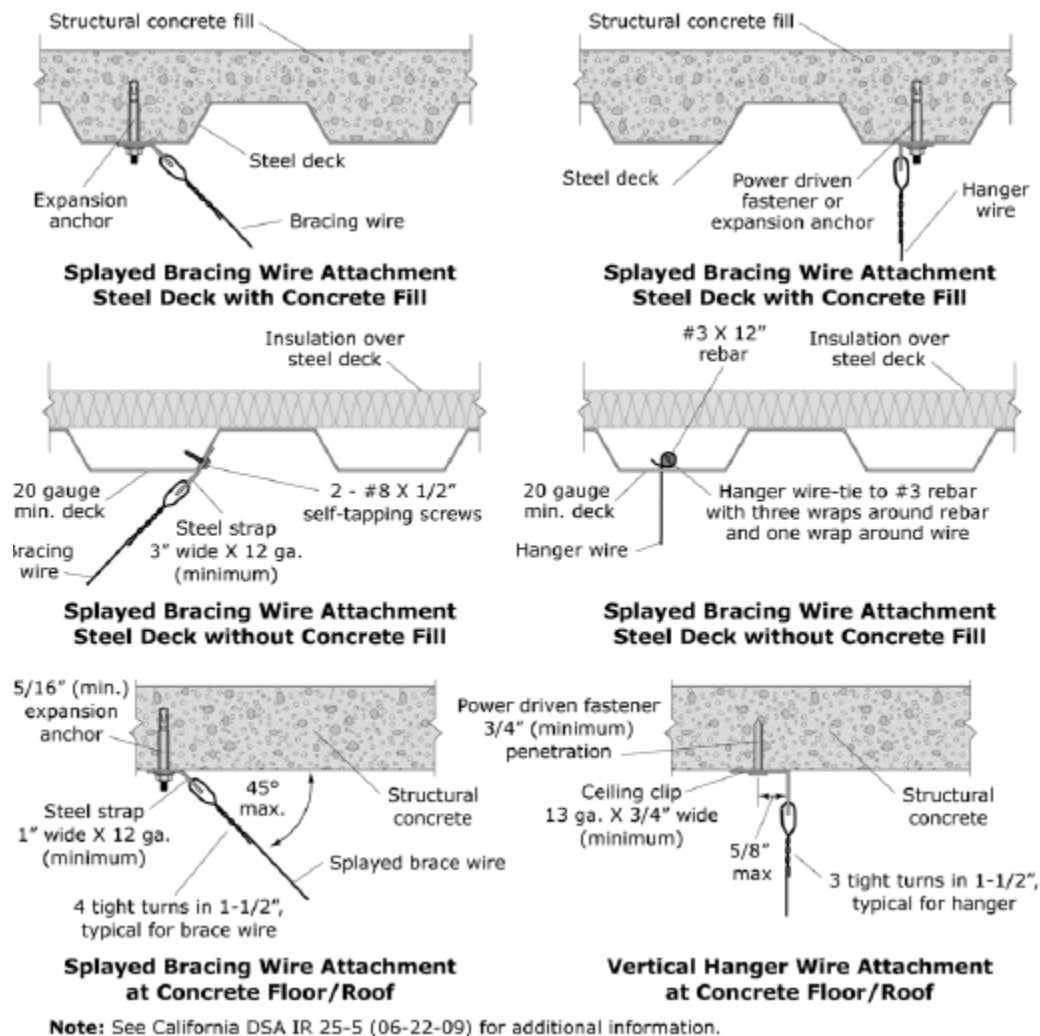


Figure G-11. Suspension System for Acoustic Lay-in Panel Ceilings – Overhead Attachment Details.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

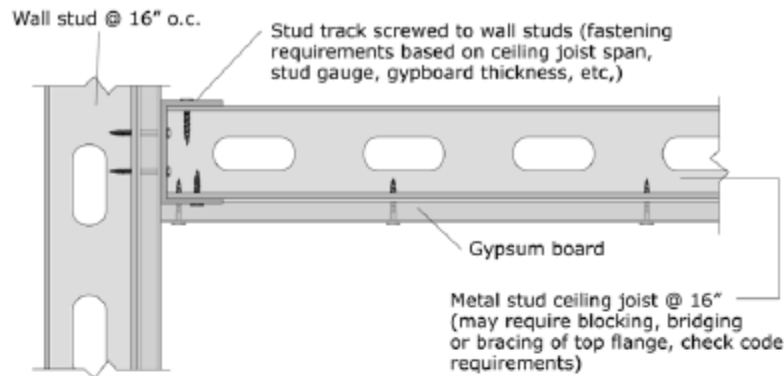

a) Gypsum board attached directly to ceiling joists

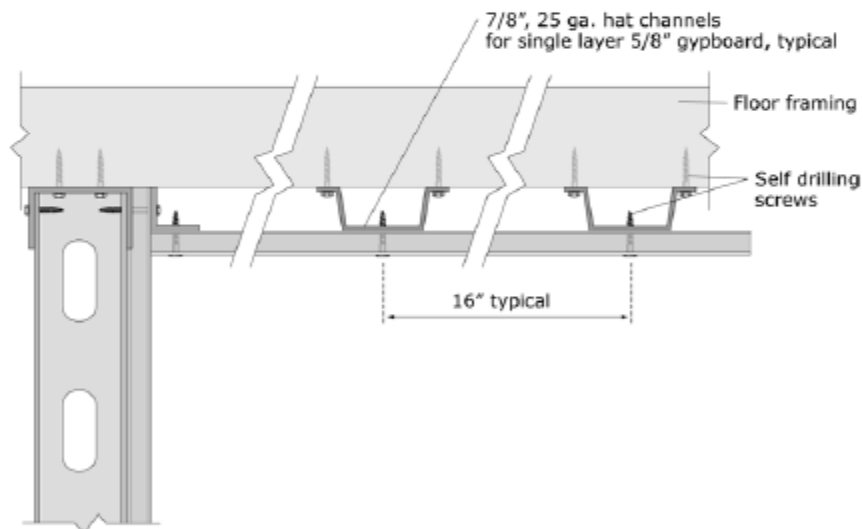

b) Gypsum board attached directly to furring strips (hat channel or similar)

Note: Commonly used details shown; no special seismic details are required as long as furring and gypboard secured. Check for certified assemblies (UL listed, FM approved, etc.) if fire or sound rating required.

Figure G-12. Gypsum Board Ceiling Applied Directly to Structure.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

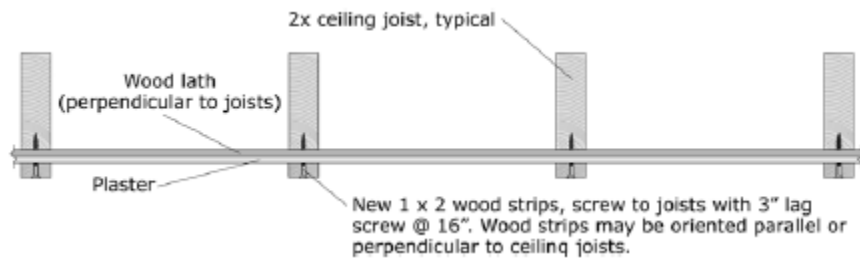


Figure G-13. Retrofit Detail for Existing Lath and Plaster.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)



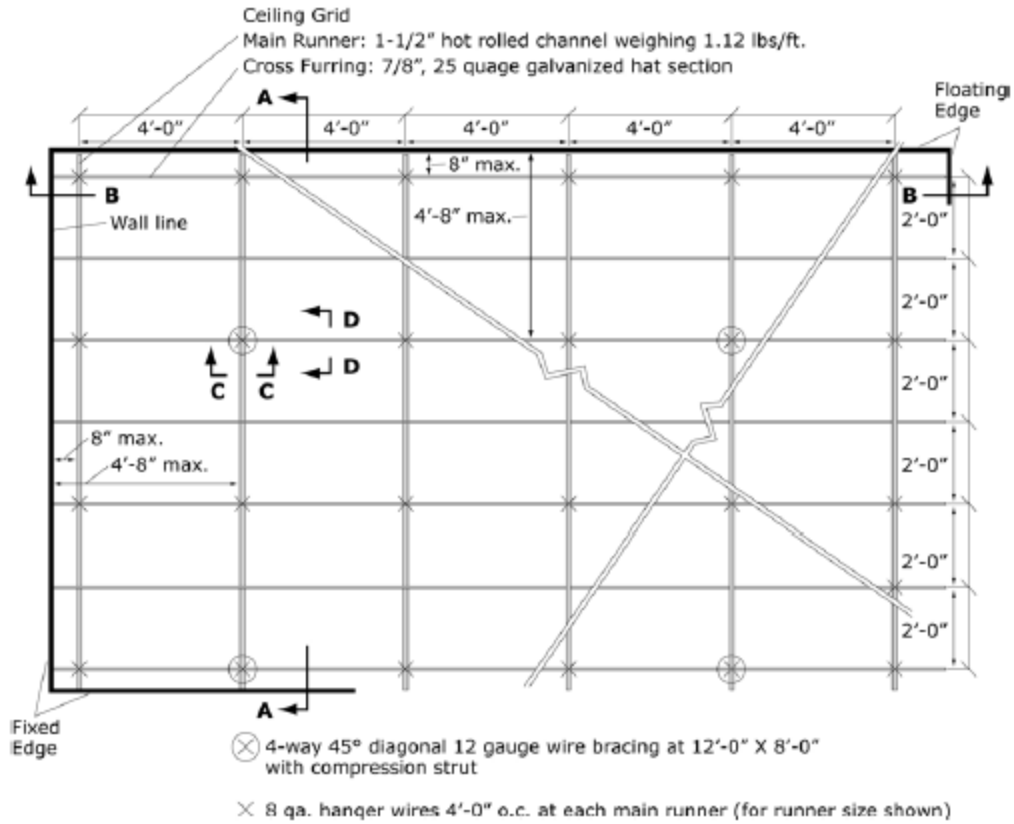


Figure G-14. Diagrammatic View of Suspended Heavy Ceiling Grid and Lateral Bracing.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

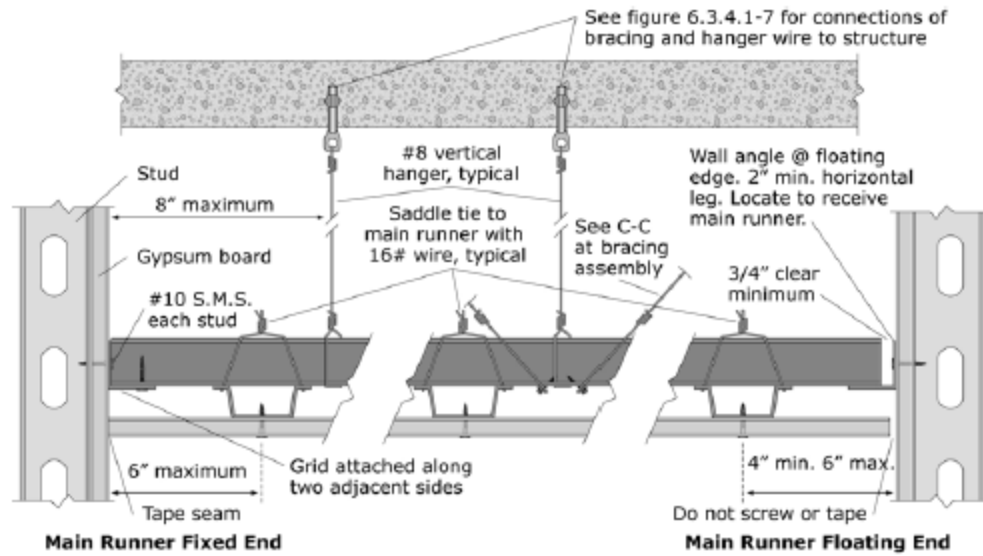


A-A Main Runner at Perimeter

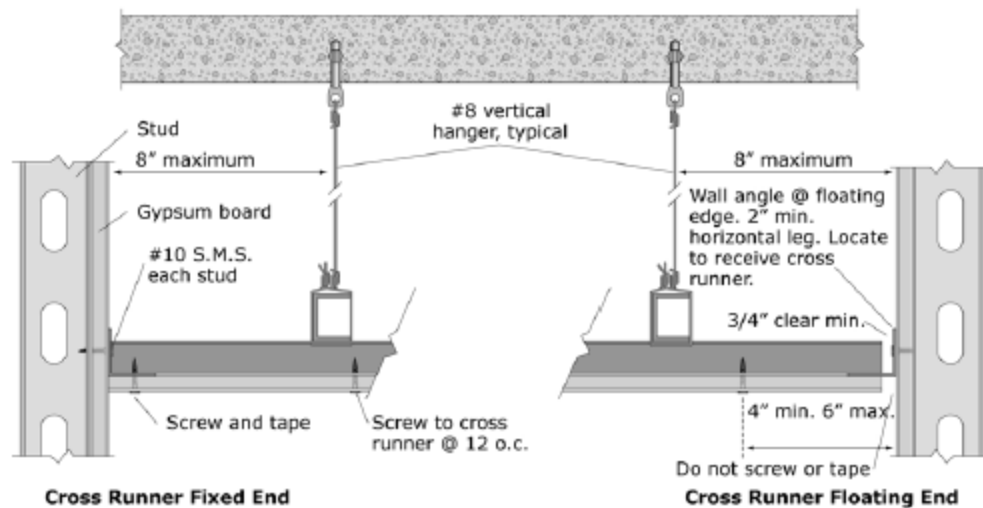

B-B Cross Runner at Perimeter

Figure G-15. Perimeter Details for Suspended Gypsum Board Ceiling.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

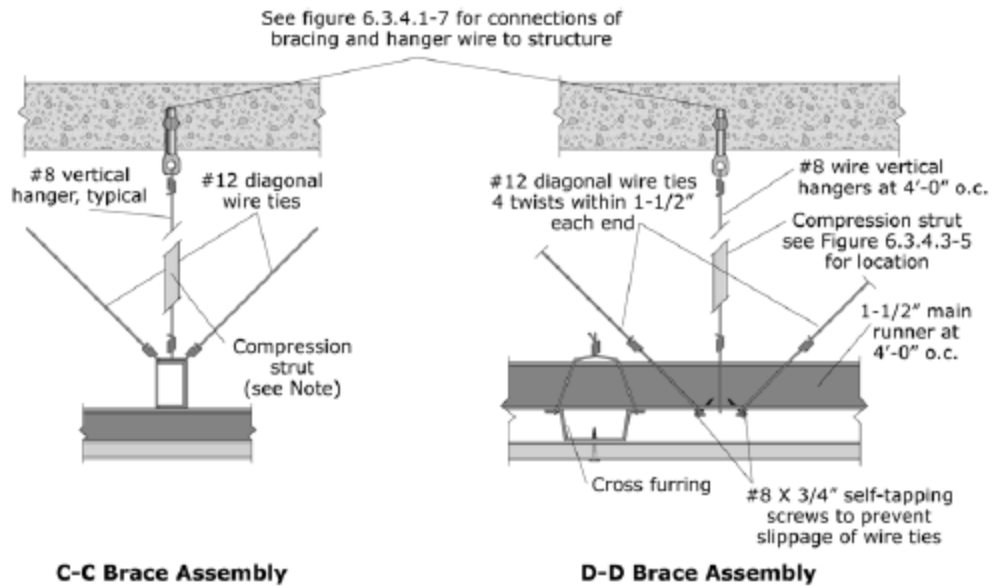

Note: Compression strut shall not replace hanger wire. Compression strut consists of a steel section attached to main runner with 2 - #12 sheet metal screws and to structure with 2 - #12 screws to wood or 1/4" min. expansion anchor to concrete. Size of strut is dependent on distance between ceiling and structure ($l/r \leq 200$). A 1" diameter conduit can be used for up to 6', a 1-5/8" X 1-1/4" metal stud can be used for up to 10'. See figure 6.3.4.1-6 for example of bracing assembly.

Figure G-16. Details for Lateral Bracing Assembly for Suspended Gypsum Board Ceiling.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Light Fixtures

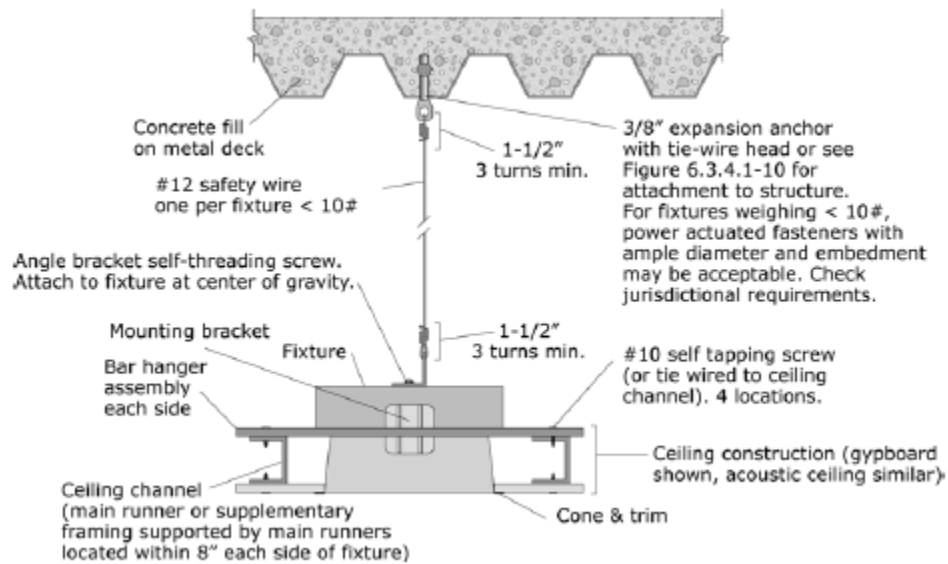


Figure G-17. Recessed Light Fixture in suspended Ceiling (Fixture Weight < 10 pounds).
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

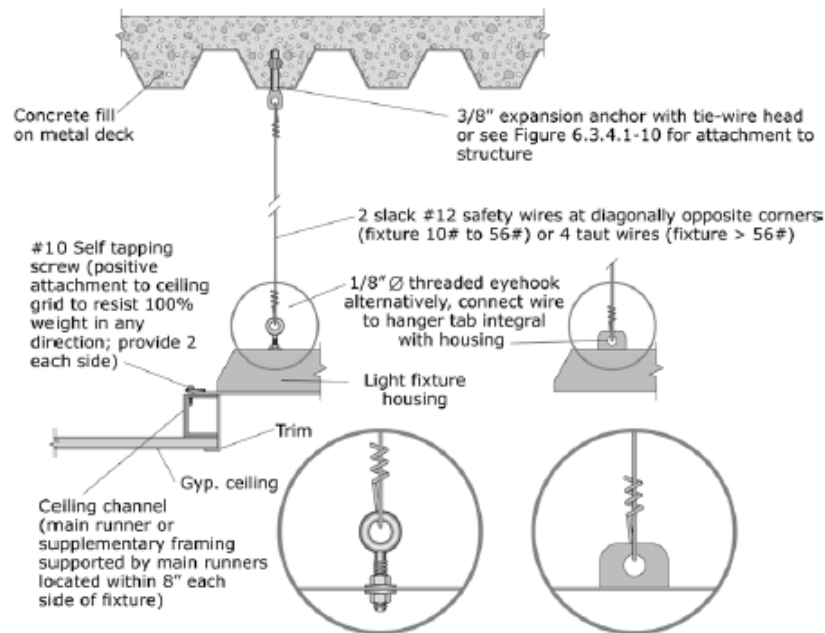


Figure G-18. Recessed Light Fixture in suspended Ceiling (Fixture Weight 10 to 56 pounds).
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Contents and Furnishings


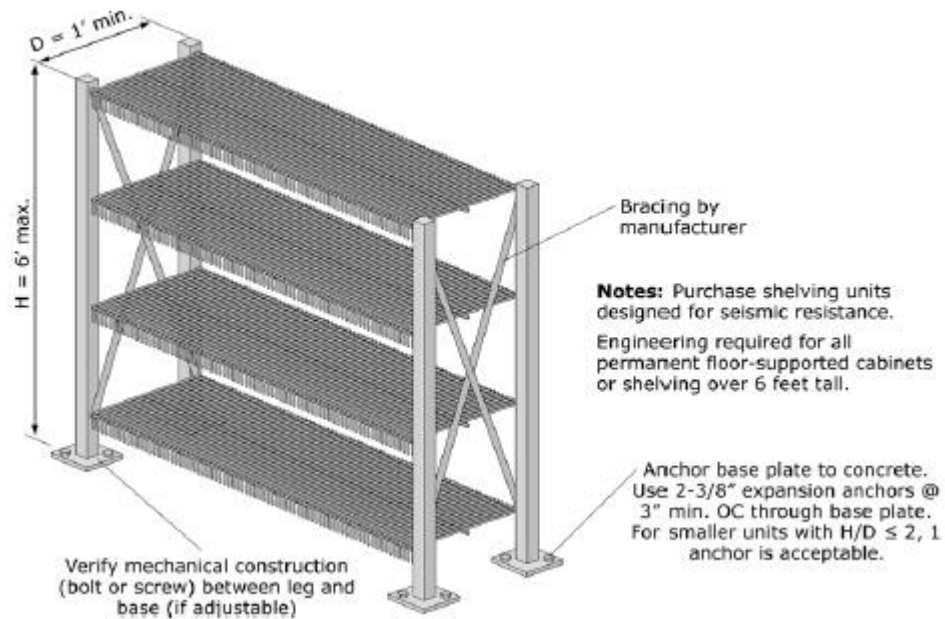


Figure G-19. Light Storage Racks.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

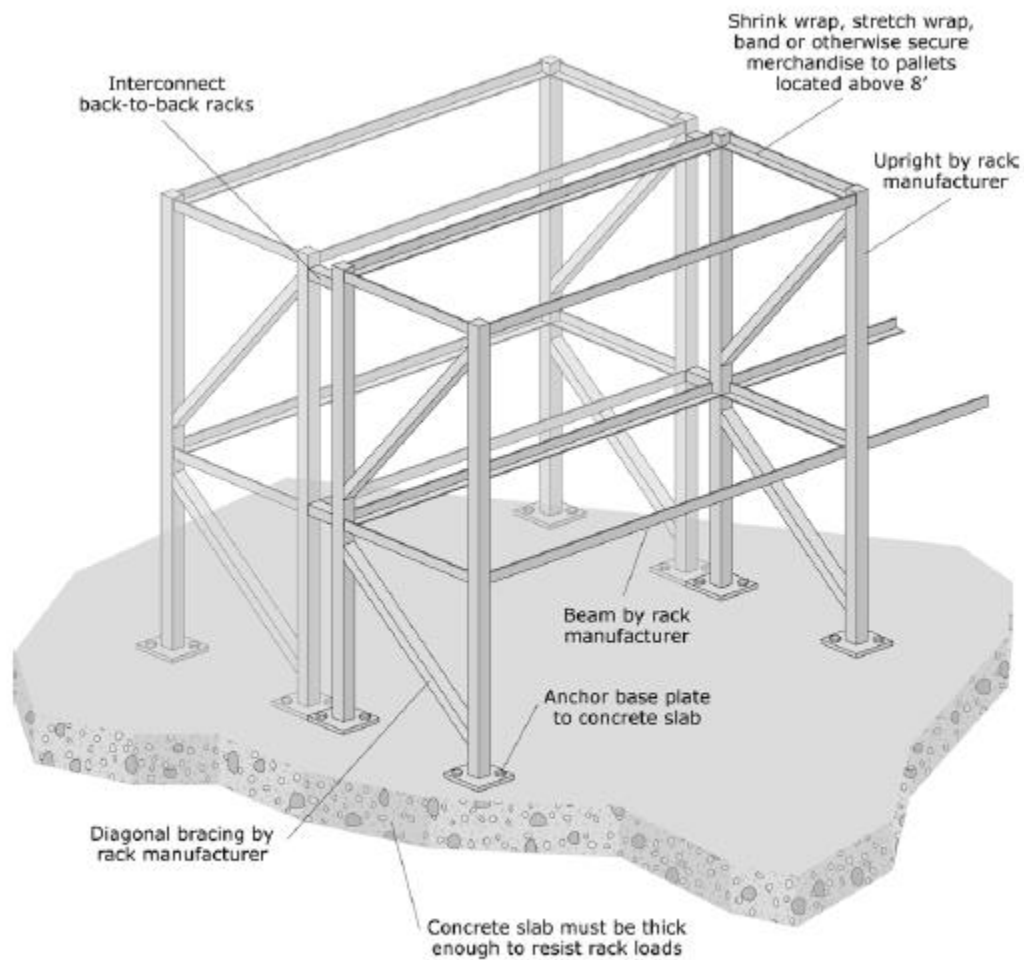

Note: Purchase storage racks designed for seismic resistance. Storage racks may be classified as either nonstructural elements or nonbuilding structures depending upon their size and support conditions. Check the applicable code to see which provisions apply.

Figure G-20. Industrial Storage Racks.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

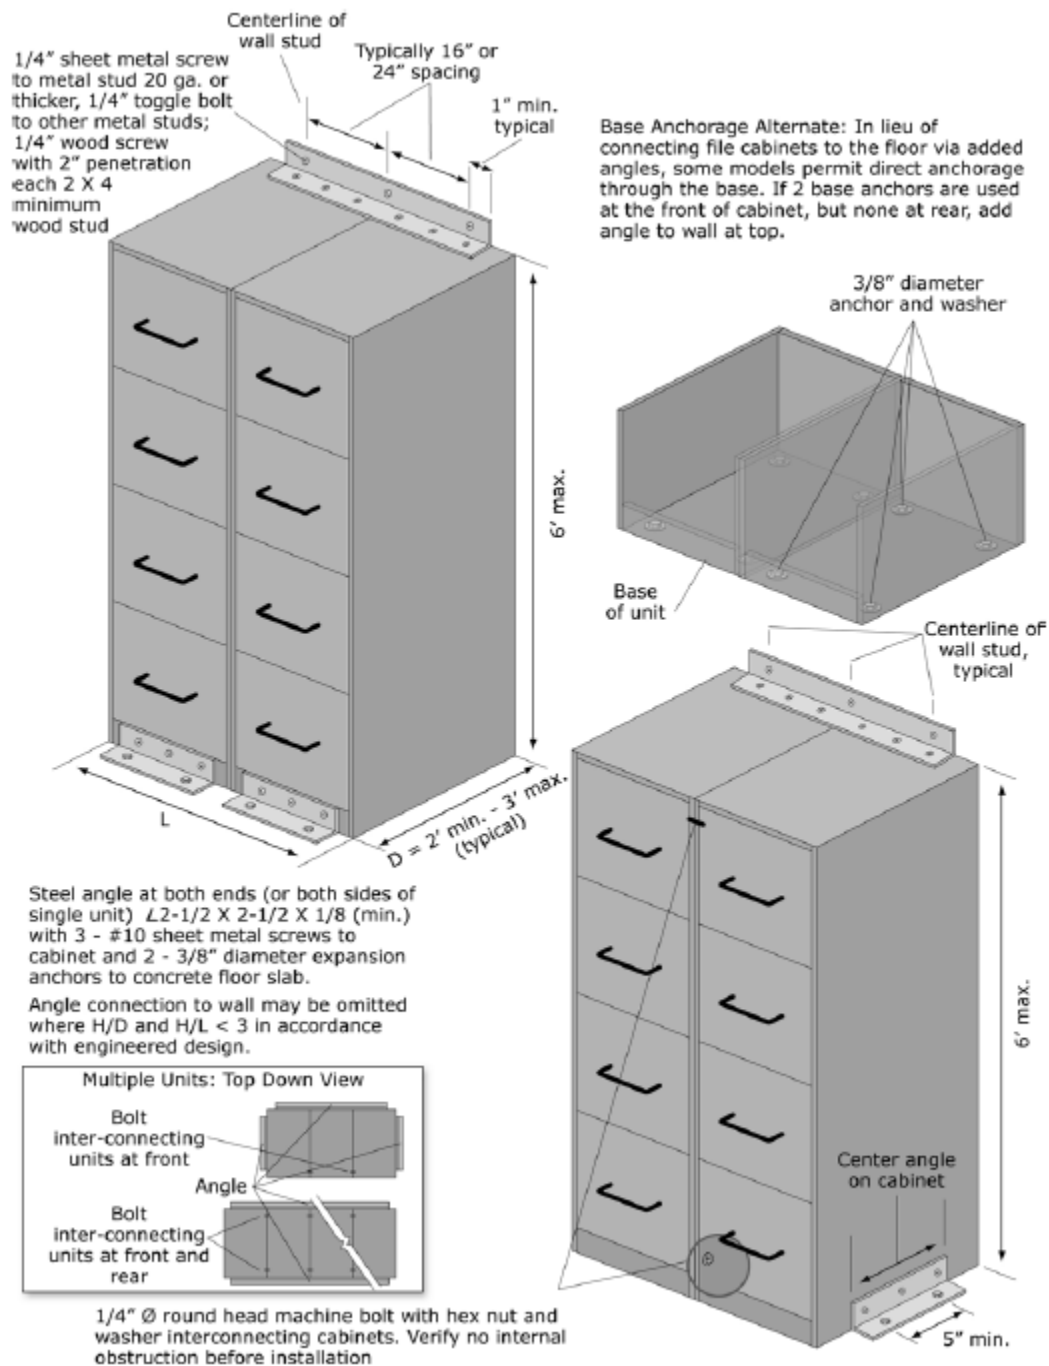


Figure G-21. Wall-mounted File Cabinets.

(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)


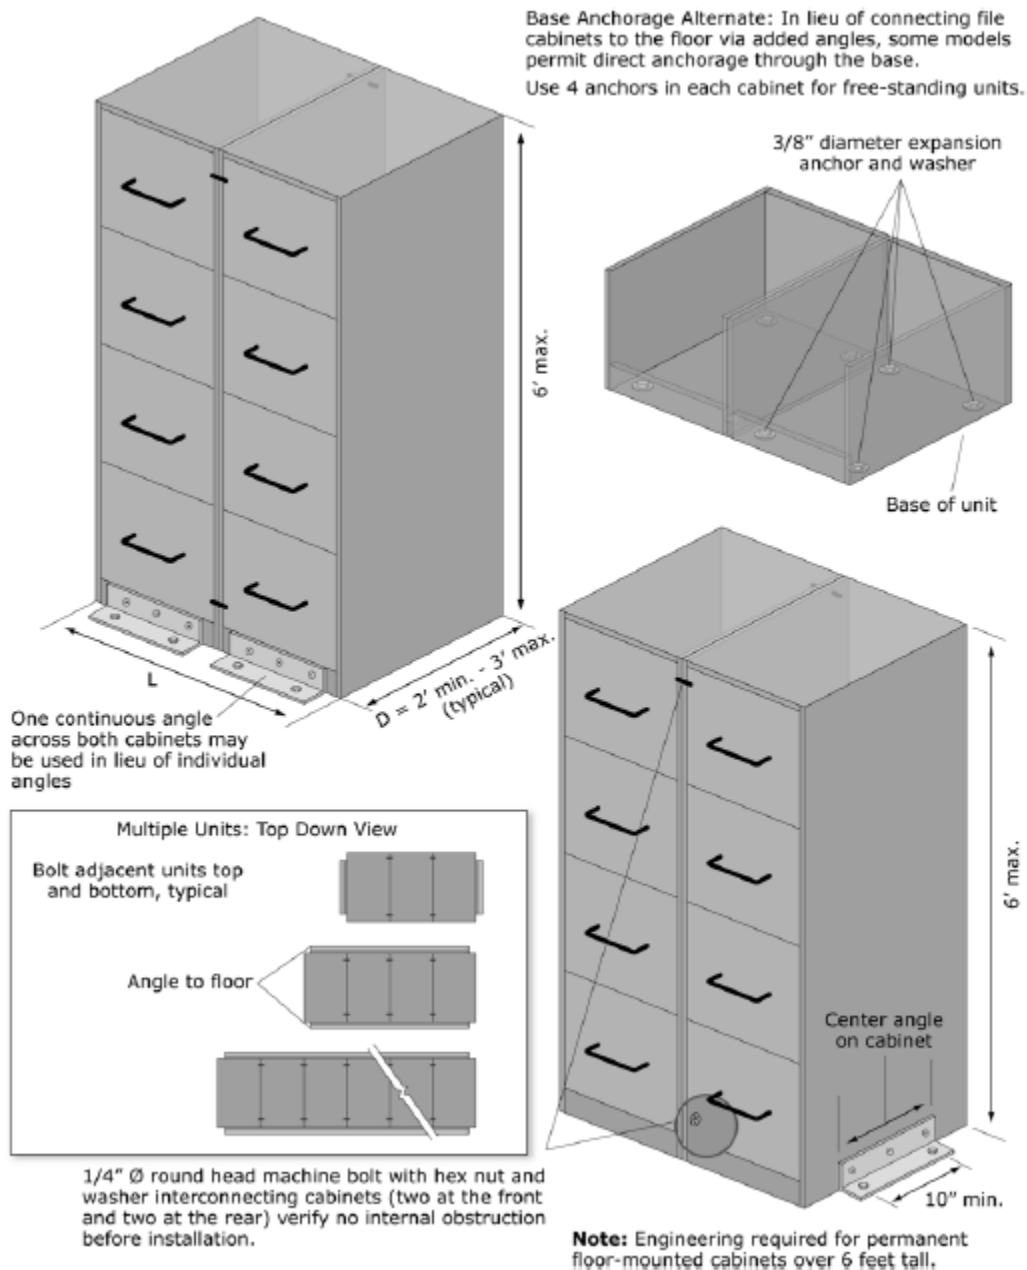


Figure G-22. Base Anchored File Cabinets.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

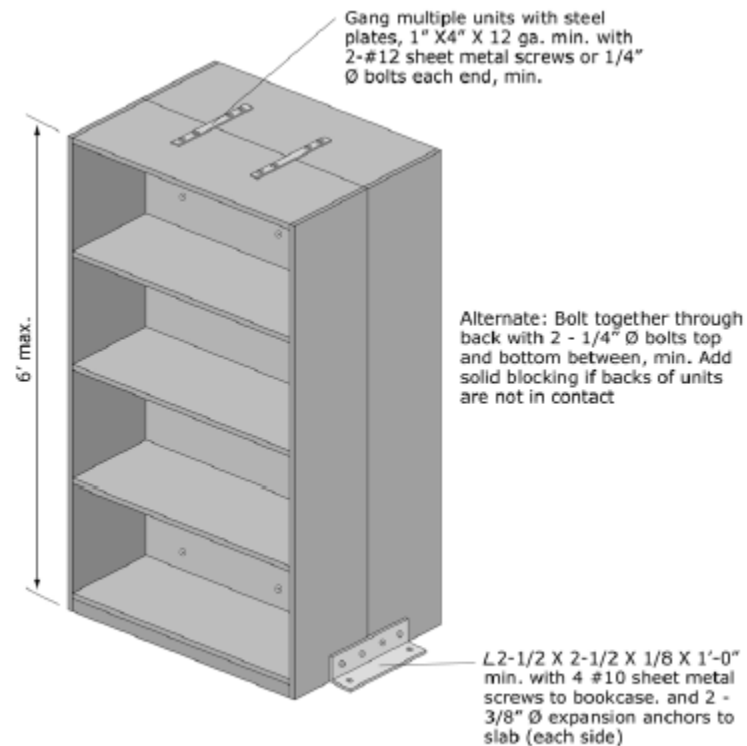

Note: Engineering required for all permanent floor-supported cabinets or shelving over 6 feet tall. Details shown are adequate for typical shelving 6 feet or less in height.

Figure G-23. Anchorage of Freestanding Book Cases Arranged Back to Back.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)



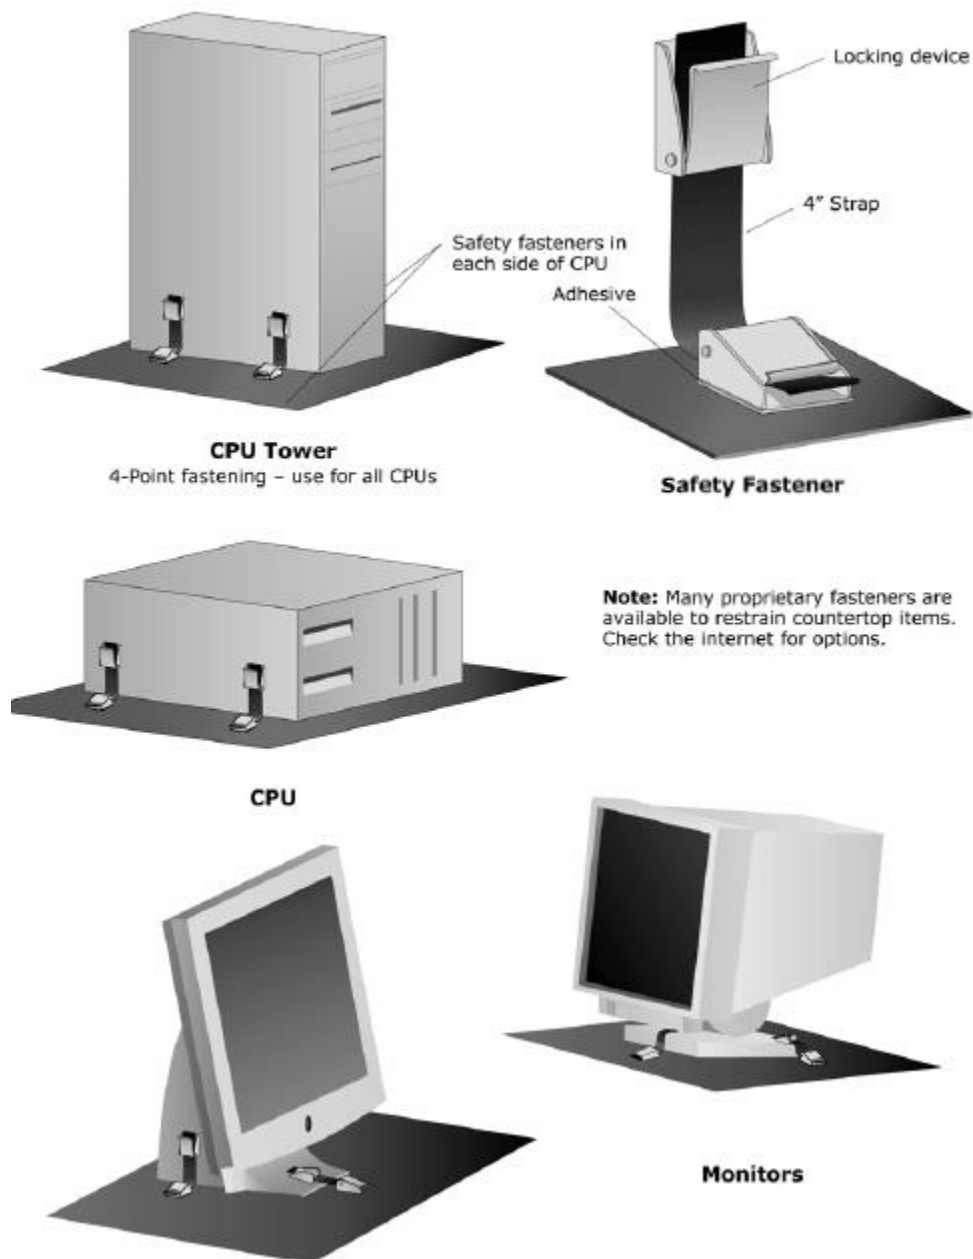


Figure G-24. Desktop Computers and Accessories.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

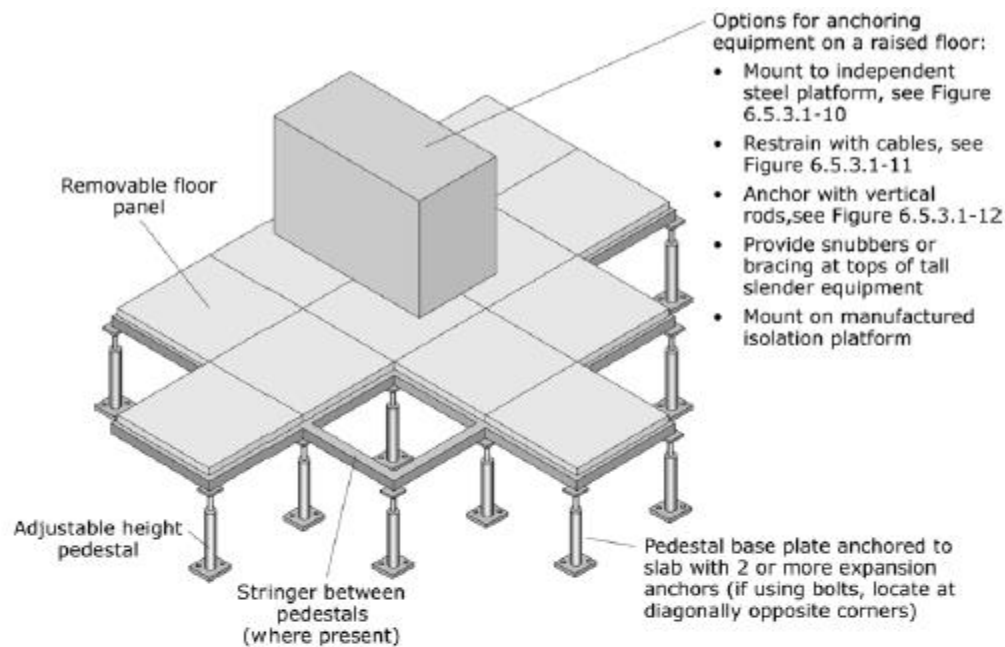


Cantilevered Access Floor Pedestal

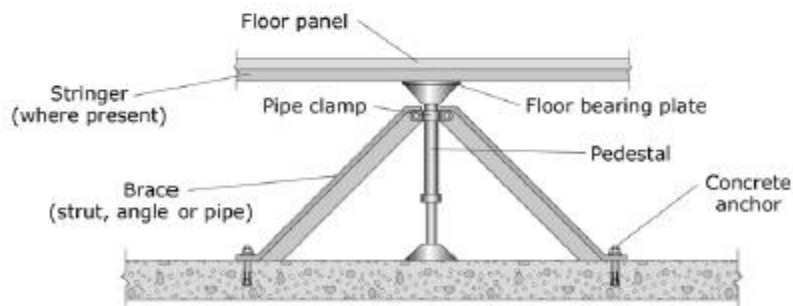

Braced Access Floor Pedestal
(use for tall floors or where pedestals are not strong enough to resist seismic forces)


Note: For new floors in areas of high seismicity, purchase and install systems that meet the applicable code provisions for "special access floors."

Figure G-25. Equipment Mounted on Access Floor.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

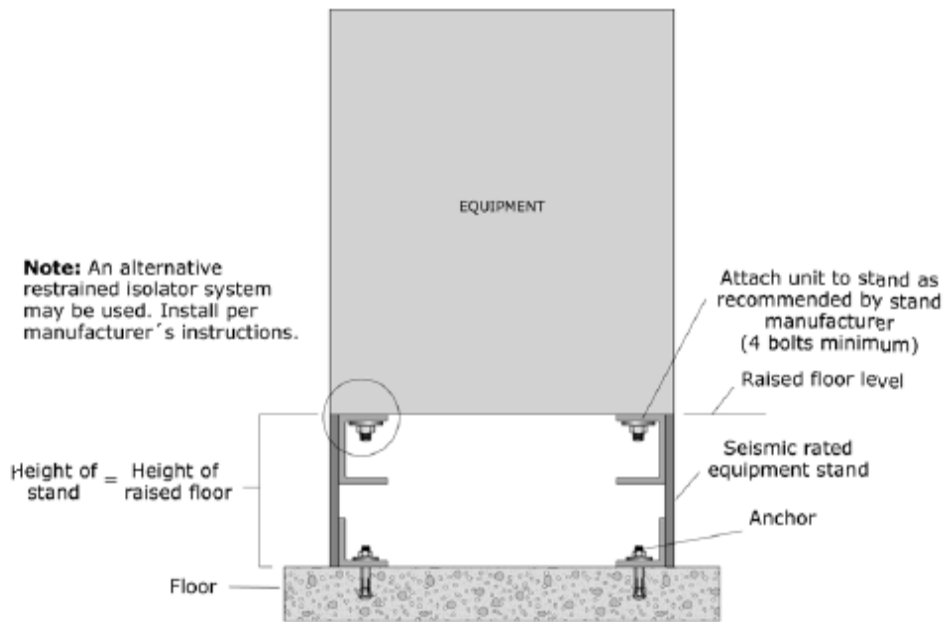


Equipment installed on an independent steel platform within a raised floor

Figure G-26. Equipment Mounted on Access Floor – Independent Base.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

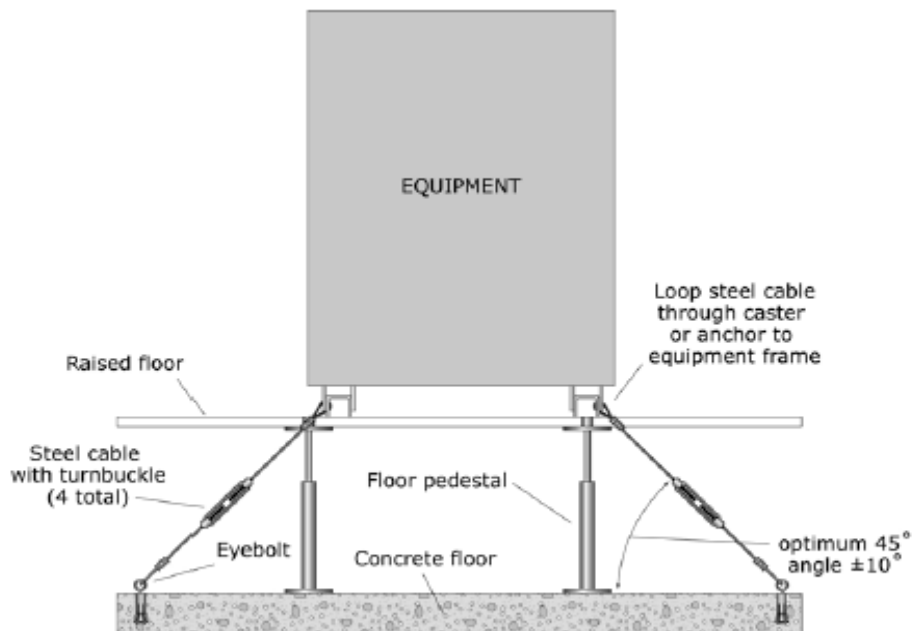

Equipment restrained with cables beneath a raised floor


Figure G-27. Equipment Mounted on Access Floor – Cable Braced.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

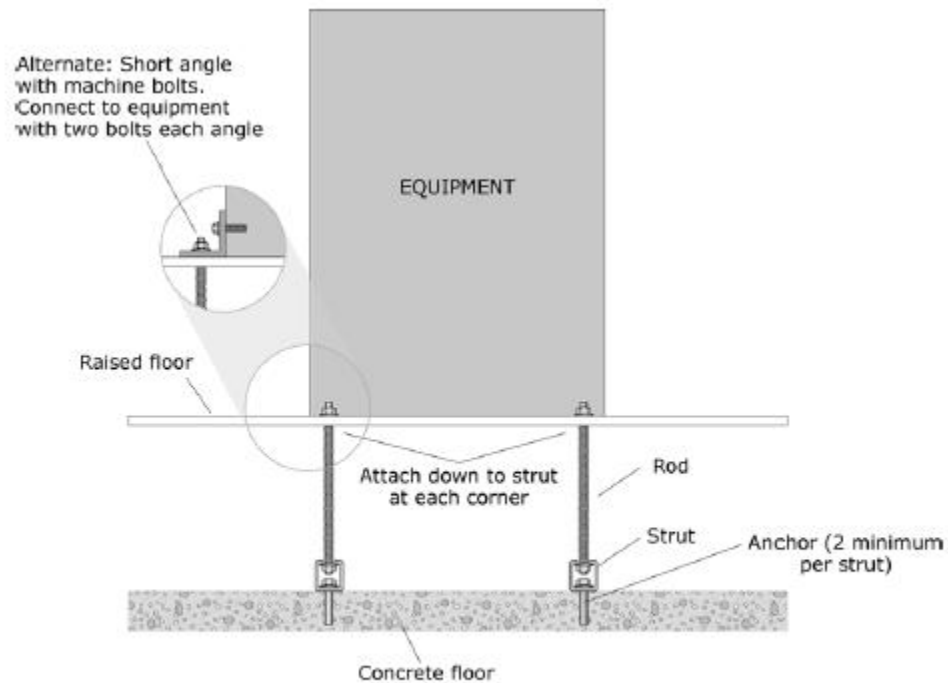

Equipment anchored with vertical rods beneath a raised floor


Figure G-28. Equipment Mounted on Access Floor – Tie-down Rods.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Mechanical and Electrical Equipment

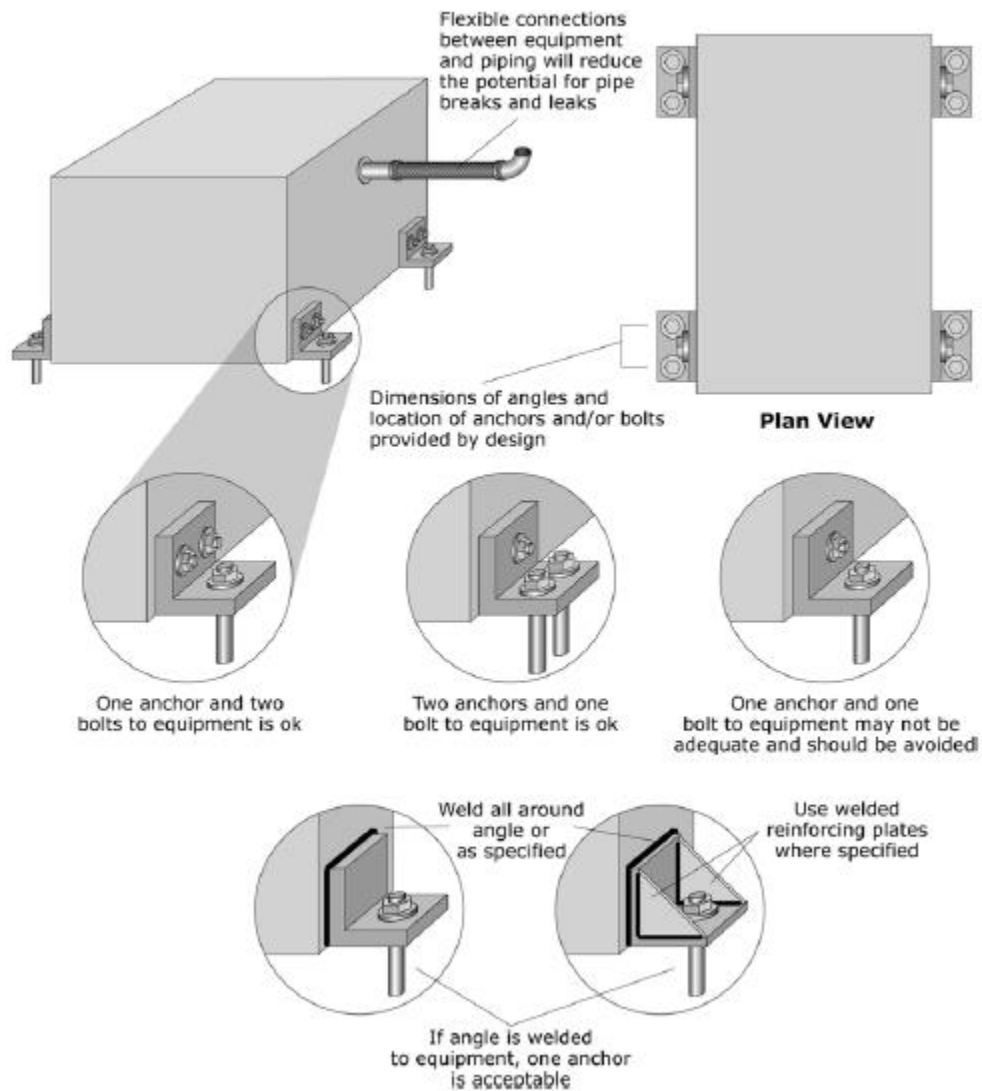


Note: Rigidly mounted equipment shall have flexible connections for the fuel lines and piping.


Figure G-29. Rigidly Floor-mounted Equipment with Added Angles.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

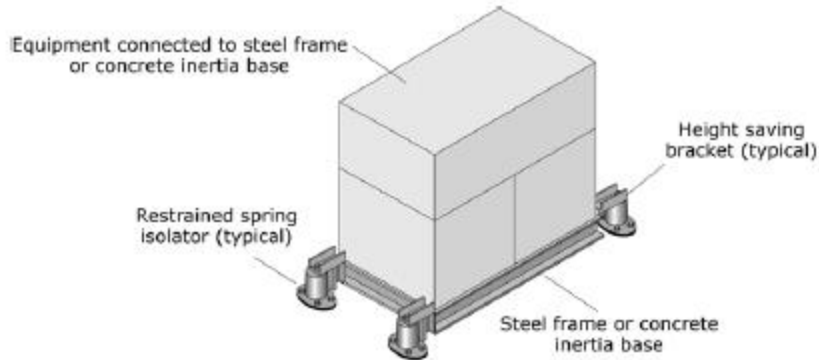

Supplemental base with restrained spring isolators

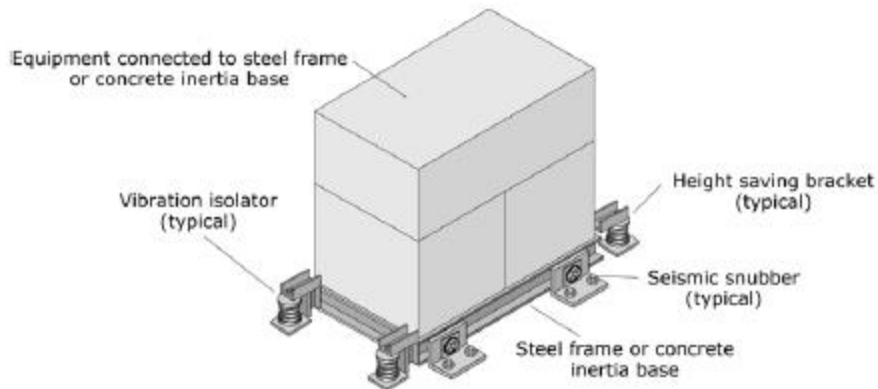

Supplemental base with open springs and all-directional snubbers

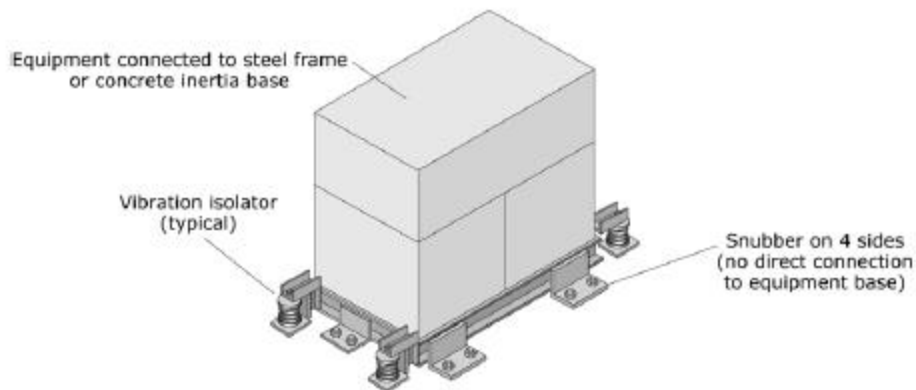

Supplemental base with open springs and one-directional snubbers

Figure G-30. HVAC Equipment with Vibration Isolation.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

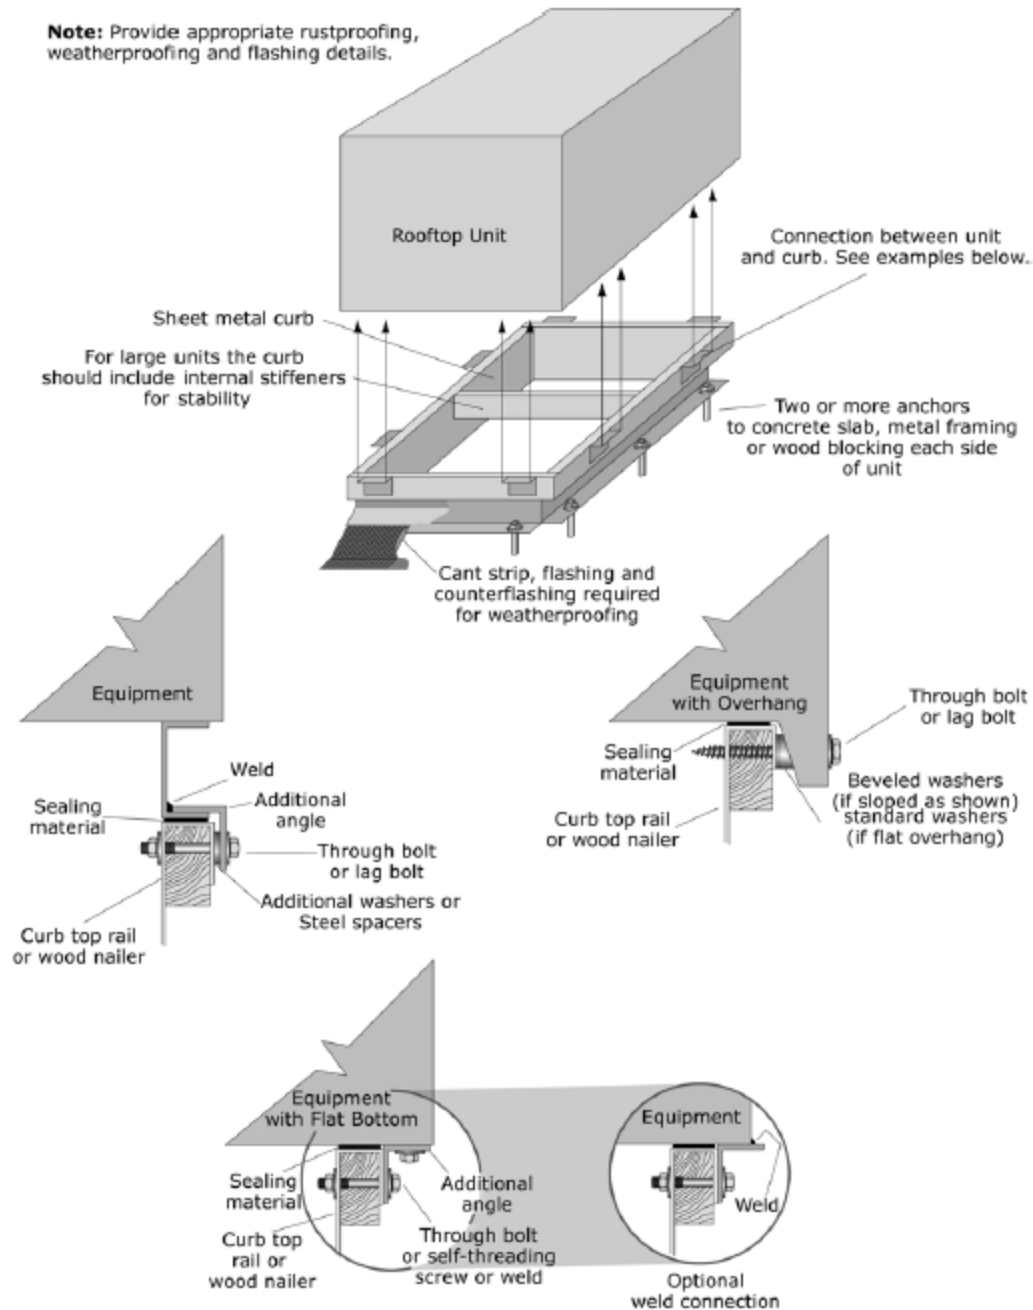


Figure G-31. Rooftop HVAC Equipment.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

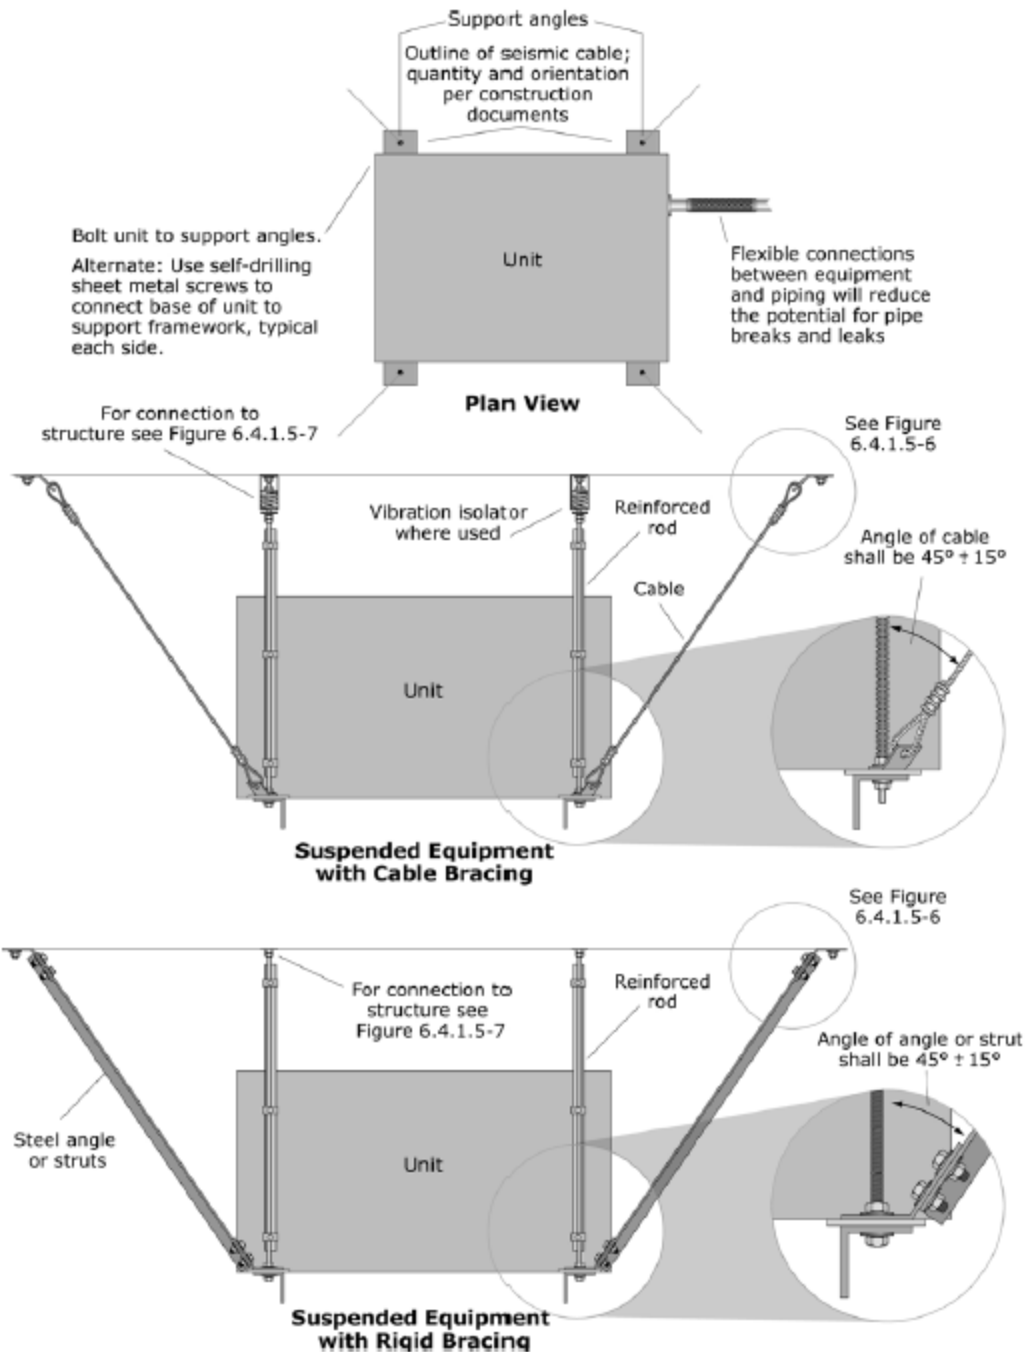


Figure G-32. Suspended Equipment.
 (FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

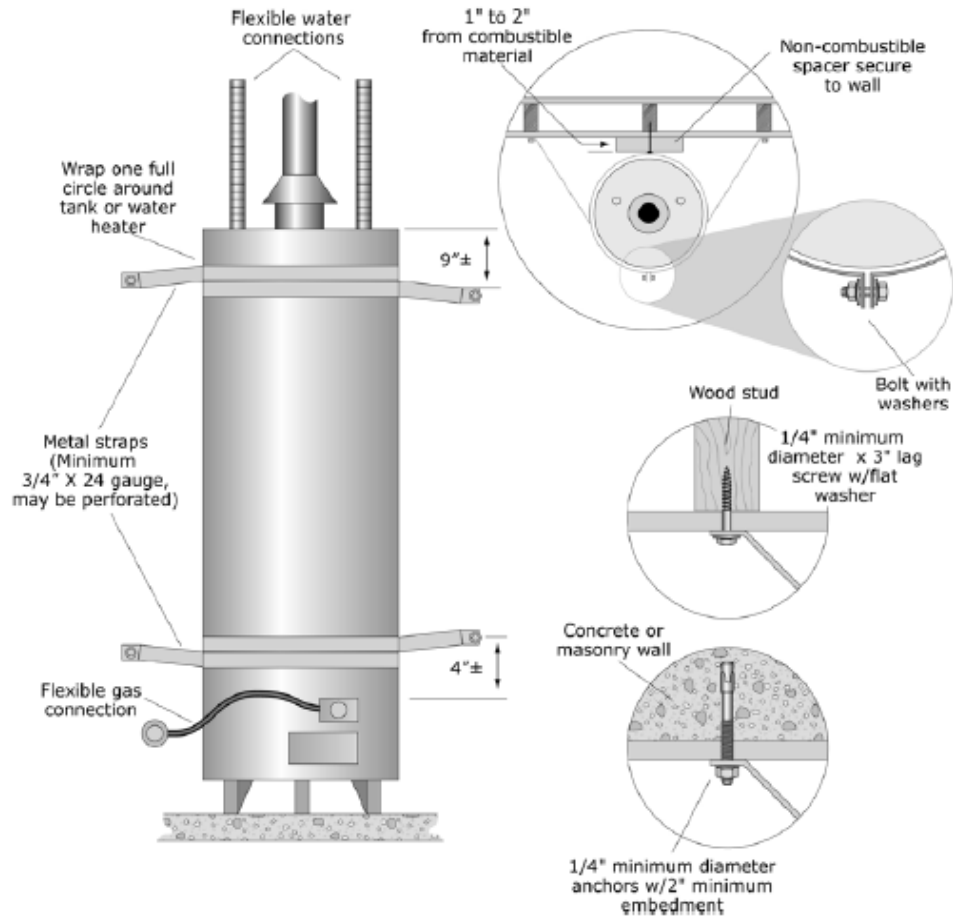


Figure G-33. Water Heater Strapping to Backing Wall.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

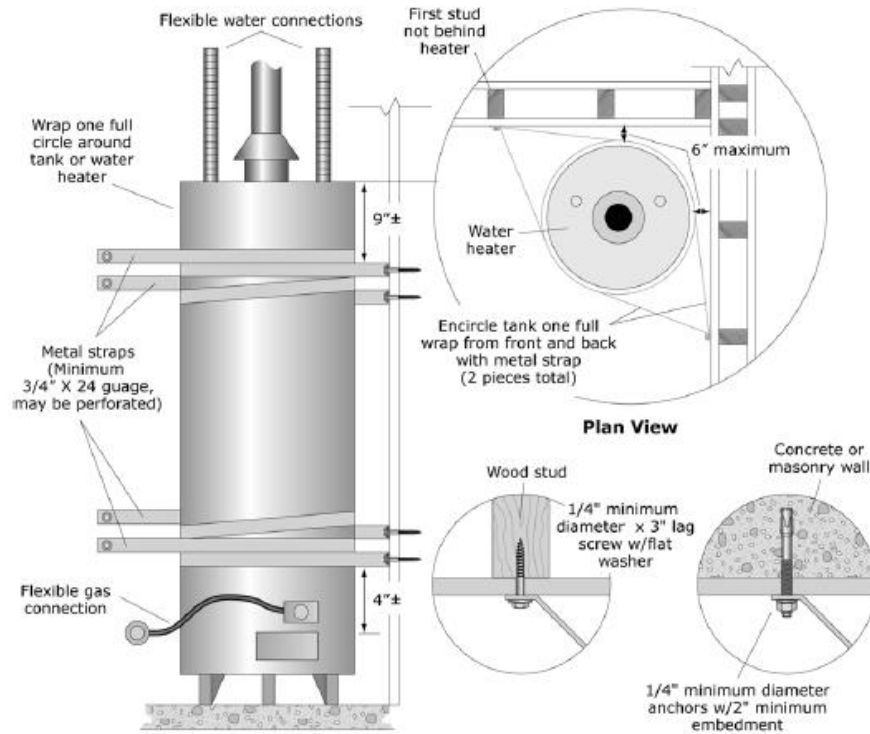


Figure G-34. Water Heater – Strapping at Corner Installation.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

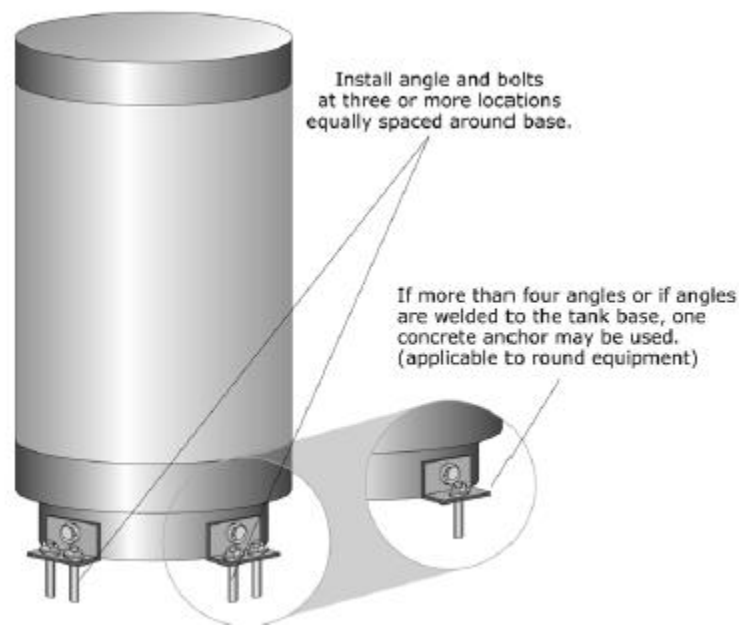


Figure G-35. Water Heater – Base Mounted.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

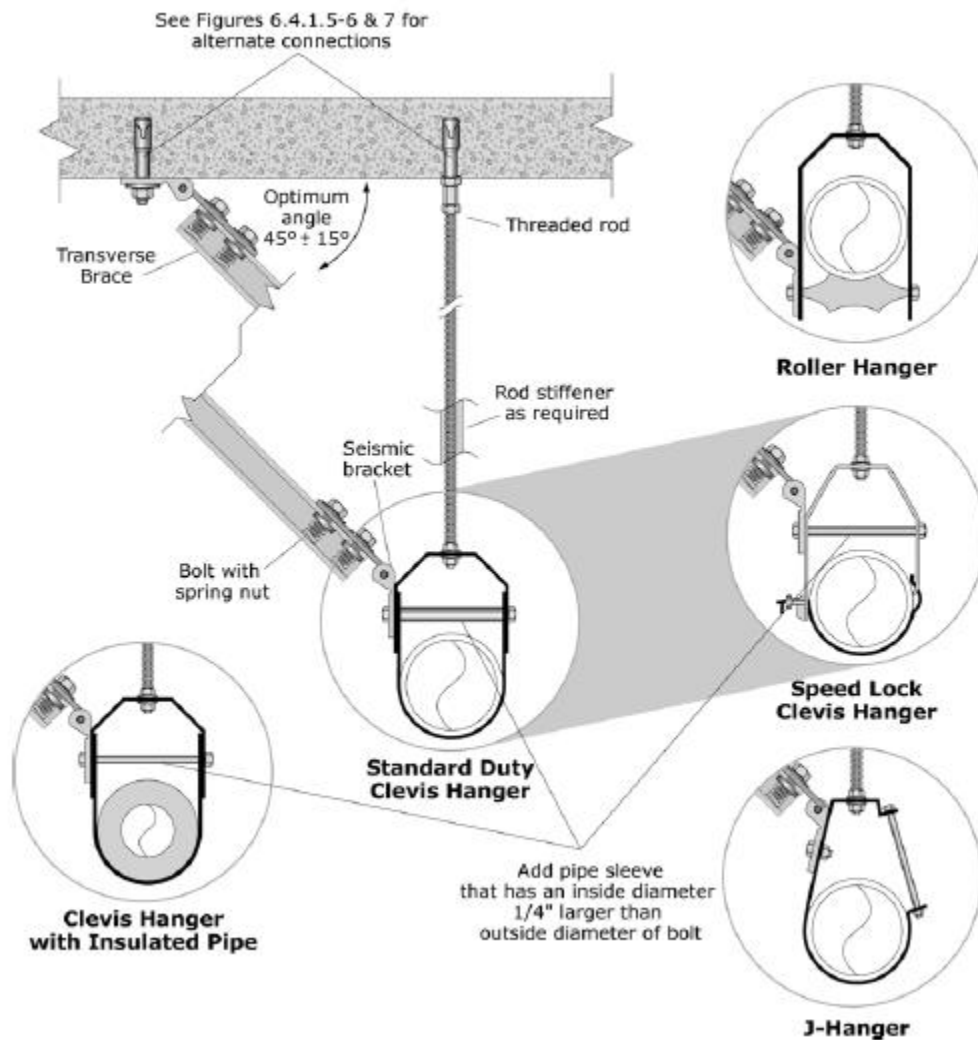


Figure G-36. Rigid Bracing – Single Pipe Transverse.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

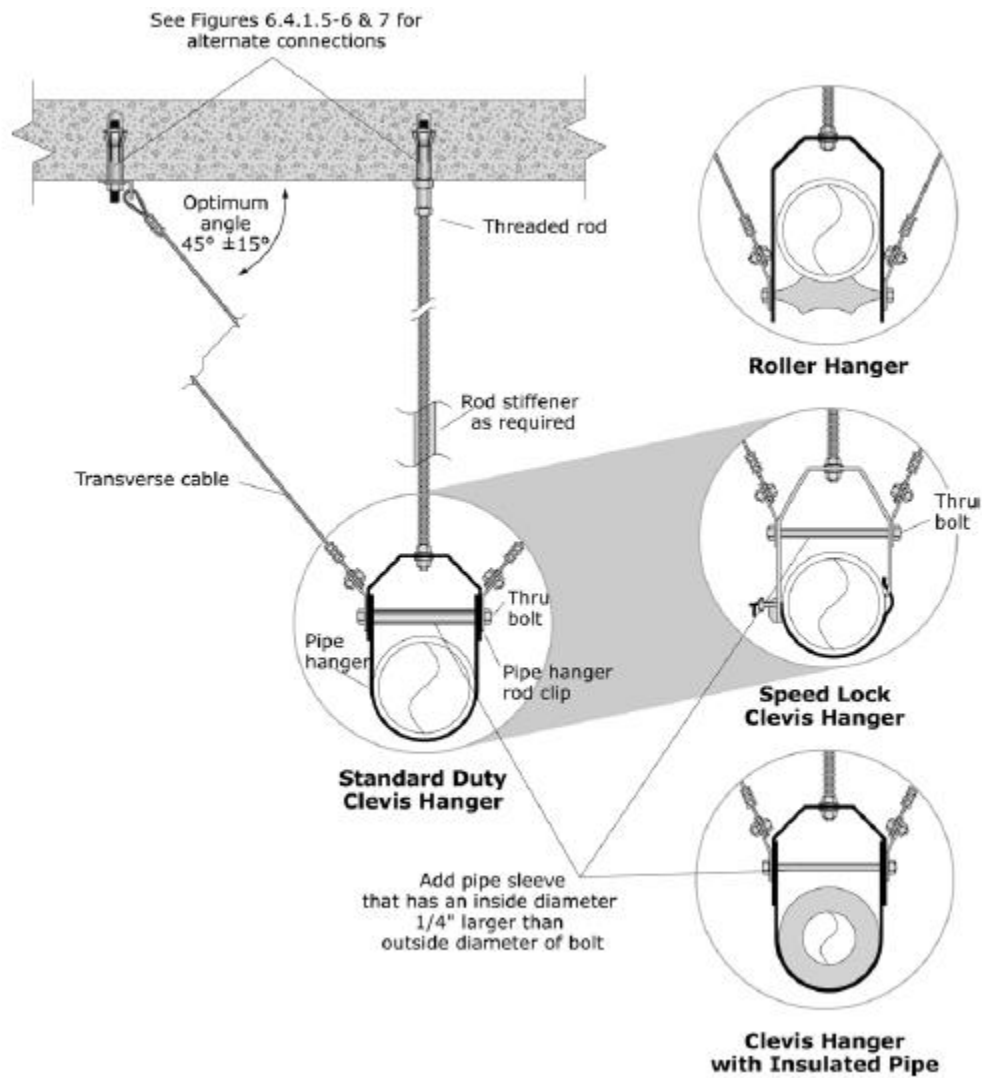


Figure G-37. Cable Bracing – Single Pipe Transverse.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Electrical and Communications

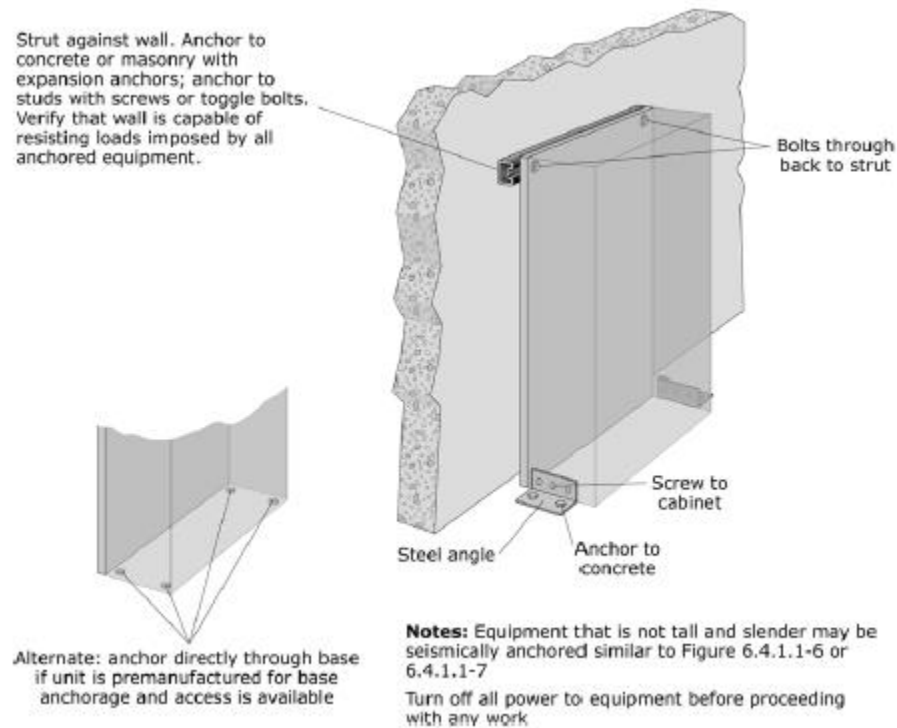


Figure G-38. Electrical Control Panels, Motor Controls Centers, or Switchgear.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

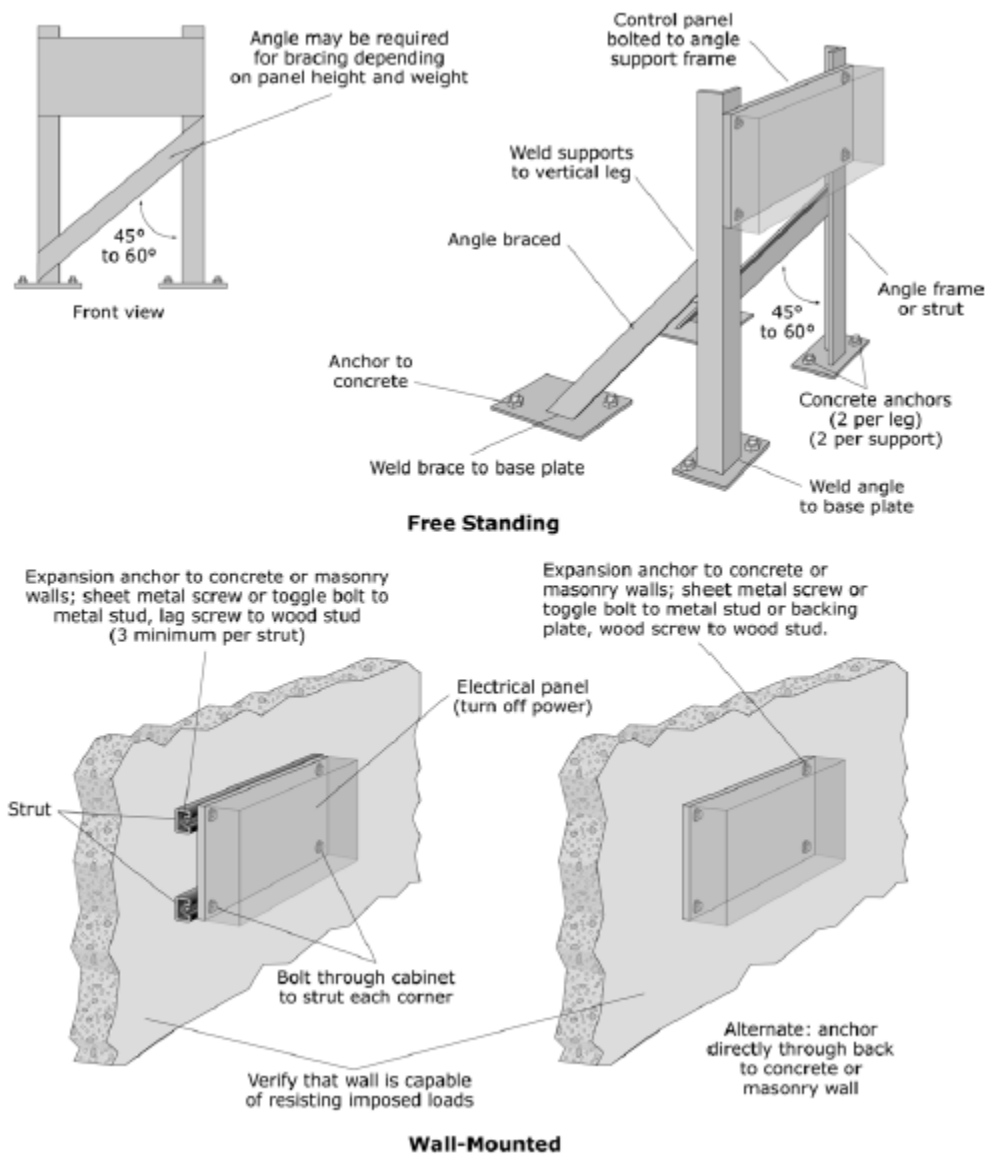


Figure G-39. Freestanding and Wall-mounted Electrical Control Panels, Motor Controls Centers, or Switchgear.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

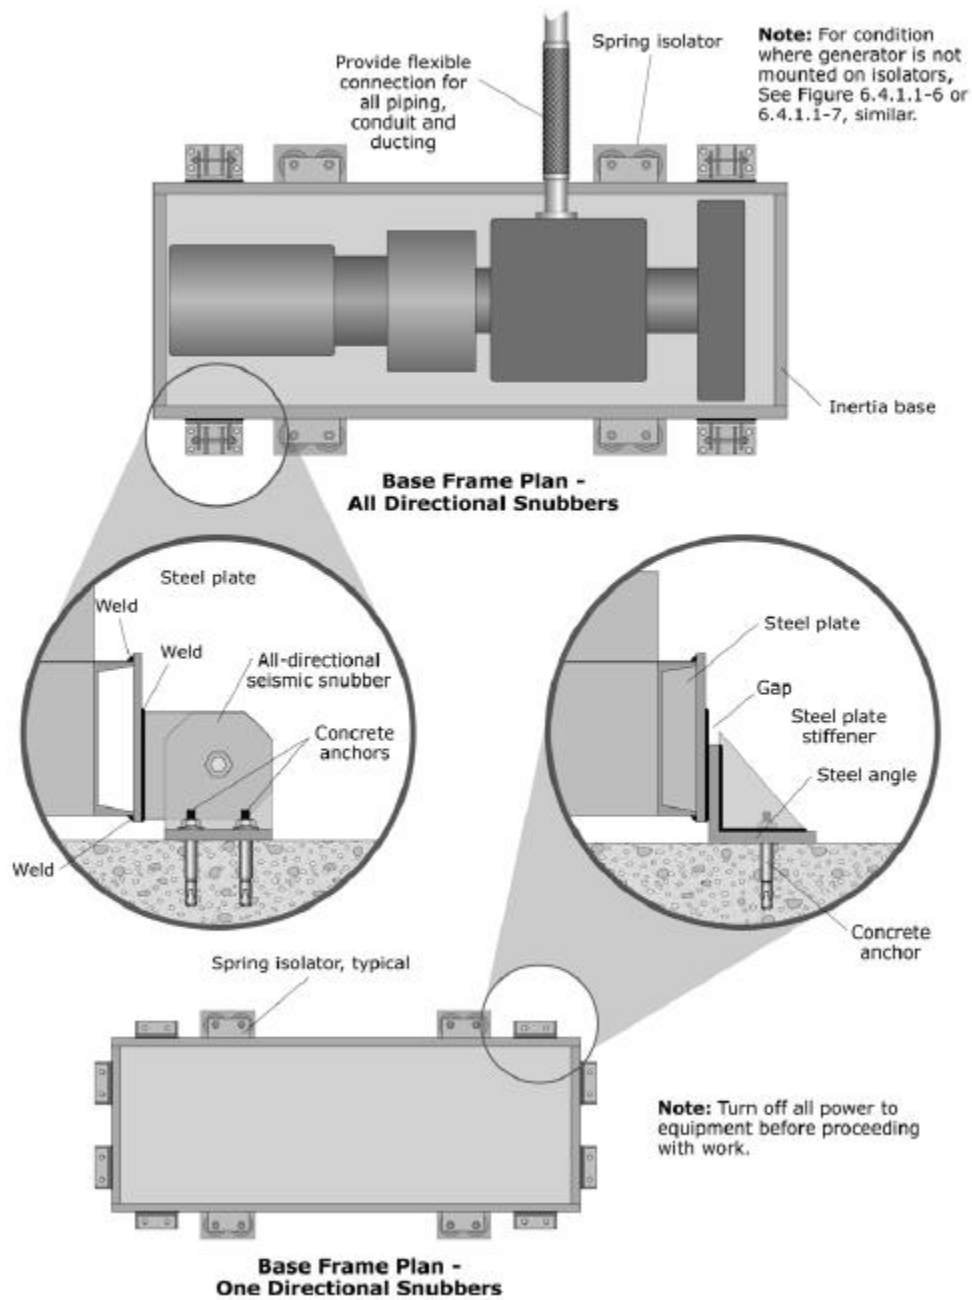


Figure G-40. Emergency Generator.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)